
### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established

T2N R39EB-19

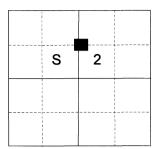

## DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

See Survey Number: 022-2022

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8" by 30" iron pin, 28" in the ground, with 2 1/2" aluminum cap, marked as shown below and in a 2 ft. diam. collar of stone, from which:

#### NEW BEARING OBJECT:

A 12" Douglas Fir bears South 70° East, a dist. of 57.50 feet scribed CN1/16 S2 BT A 4" White Fir bears South 27° West, a dist. of 52.85 feet scribed CN1/16 S2 BT

Set steel fence post approx. 1 ft. South

Monument falls approx. 15 feet Southeasterly of fence corner, from which fences bear West and South.


I hereby certify that the corner was monumented on July 6, 2022.

Witness: Kyle Tucker and Dan Drum

REGISTERED PROFESSIONAL LAND SURVEYOR

ÓREGON June 2, 2010 JEFFREY S. HSU 83571

Renewal Date: June 30, 2023

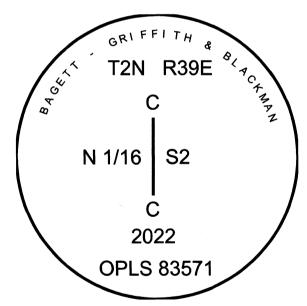

UNION COUNTY
SURVEYOR

Date Received 7114127

Th4/27

Filed By Mild Norm Deforty

File Number 022-20228

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.