
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Not previously established.

T 2 N R 39 E C-22

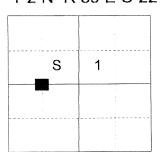

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

See Survey 013-2020

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by survey I set a 5/8" x 30" iron pin, 28" in the ground, with 2 1/2" aluminum cap marked as shown below, in a 1.5 ft. diam. mound of stone, from which:

NEW BEARING OBJECTS:

An 11" Ponderosa Pine bears North a dist. of 28.60 ft., marked CW 1/16 S1 BT. An 11" Douglas Fir bears North 86° East a dist. of 37.25 ft., marked CW 1/16 S1 BT.

Set steel fence post approx. 1 ft. West.

I hereby certify that the corner was monumented on April 14, 2020. Witness: Kyle A. Tucker

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571


Renewal Date: June 30, 2021

UNION COUNTY
SURVEYOR

Date Received 4/70/70

Date Filed 4/70/70

File Number 021-20707

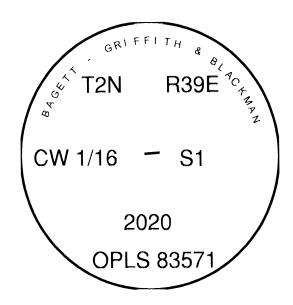

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.