


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Rufus Moore in GLO contract no. 382, dated March 23, 1881. Surveyor General field notes state:

Set post for cor. to secs. 3, 4, 9 and 10, from which:
A Tamarack 12 in diam bears N 16° W, 18 lks dist
A Tamarack 14 in diam bears S 44° W, 19 lks dist
A Fir 10 in diam bears N 15° E, 16 lks dist
A Fir 12 in diam bears S 37° E, 24 lks dist

T 2 N R 39 E E-13

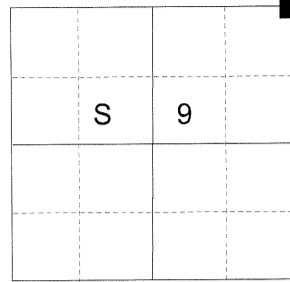

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

SEE SURVEY NUMBER 065-2015

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the proportionate position, I set a 2 1/2" x 30" aluminum pipe, with a 2 1/2" aluminum cap, marked as shown below, 30" in the ground with a collar of stone 1.5 feet diameter.
From which:

NEW BEARING TREES:

A 4" Douglas Fir bears North, a distance of 21.25 feet, marked X BT.
A 14" Western Larch bears South 78° East, a distance of 11.90 feet, marked T2N R39E S10 BT.
A 5" Douglas Fir bears South 54° West, a distance of 31.20 feet, marked T2N R39E S9 BT.
An 11" Western Larch bears North 41° West, a distance of 47.70 feet, marked T2N R39E S4 BT.


I set a steel fencepost approximately 1 foot North of the corner monument.

I hereby certify that the corner was monumented on October 27, 2015.

Corner falls in an old downed East/West running fenceline.

Witness: Thomas J. Kopp

UNION COUNTY SURVEYOR
Date Received 11/2/15
Date Filed 11/2/15
Filed By [Signature]
File Number 154-2015R

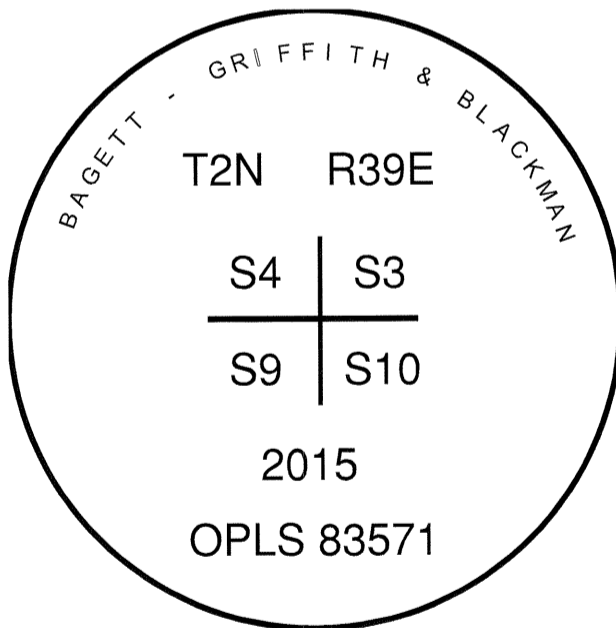

REGISTERED PROFESSIONAL LAND SURVEYOR

[Signature]
OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 15° East declination. The distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.