UNION COUNTY SURVEYOR CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner not previously established.

No record of monumentation found in UNION COUNTY survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Corner not previously established.

See Survey Number 015-2005.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by said survey, I set a $5/8" \times 30"$ iron pin with 1 ½" aluminum cap marked as shown below, 27" in the ground, from which:

NEW BEARING TREES:

A 10 inch diameter Tamarack bears S $22^{\circ}E$, a distance of 27.30 feet, marked SE1/16 S8 BT.

A 14 inch diameter Douglas Fir bears S $59^{\circ}W$, a distance of 13.95 feet, marked SE1/16 S8 BT.


Set steel fence post approximately 1 ft North of monument.

I hereby certify that the corner was monumented on July 7, 2005. Witness: Greg Blackman Jr., Mark Brooks and Rick Thew

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
July 17, 1936
RICK G. ROBINSON
2219

Renewal Date: December 31, 2006

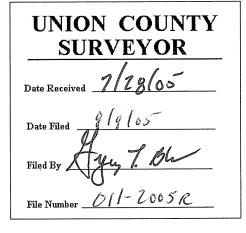



T2N R39EH-08

8

S

I used a steel tape and magnetic compass in the establishment of new accessories. The magnetic declination used was 17° East. The distance to the bearing trees is to a 50d spike driven on the right side of the tree at the root crown. I attached a brass washer marked OPLS 2219 to the BT blaze.