


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Rufus Moore in GLO contract no. 382, dated March 23, 1881. Surveyor General field notes state:

Set post for 1/4 Sec Cor, from which:
A fir 5 in diam bears N 68° W, 11 lks dist
A fir 10 in diam bears S 29° W, 44 lks dist

T 2 N R 39 E J-11

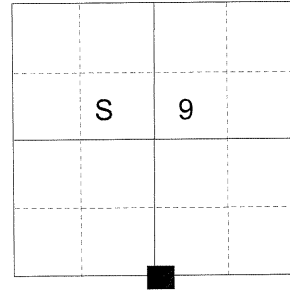

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

SEE SURVEY NUMBER 065-2015

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the proportionate position, I set a 2 1/2" x 30" aluminum pipe, with a 2 1/2" aluminum cap, marked as shown below, 28" in the ground with a collar of stone 1 foot diameter.
From which:

NEW BEARING TREES:


An 8" White Fir bears North 15° East, a distance of 23.45 feet, marked 1/4 S9 BT.
An 8" White Fir bears South 87° East, a distance of 73.85 feet, marked 1/4 S16 BT.
A 7" White Fir bears South 30° West, a distance of 56.45 feet, marked 1/4 S16 BT.
A 7" White Fir bears North 86° West, a distance of 21.45 feet, marked 1/4 S9 BT.

I set a steel fencepost approximately 1 foot North of the corner monument.

I hereby certify that the corner was monumented on October 27, 2015.

Witness: Thomas J. Kopp

UNION COUNTY SURVEYOR
Date Received 11/2/15
Date Filed 11/2/15
Filed By [Signature]
File Number 159-2015R

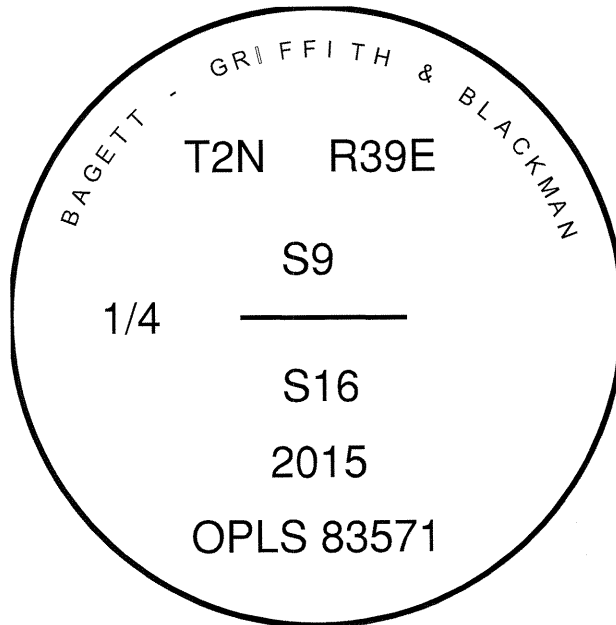

REGISTERED PROFESSIONAL LAND SURVEYOR
[Signature]
OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 15° East declination. The distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.