
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Rufus Moore in GLO contract no. 382, dated March 23, 1881. Surveyor General field notes state:

Set basalt stone 14x10x6 in mound of stone for 1/4 Sec Cor, from which: A pine 40 in diam bears N 22° E, 139 lks dist

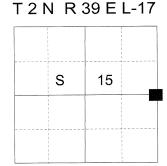

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

SEE SURVEY NUMBER 065-2015

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by survey, I set a $5/8" \times 15"$ iron pin with a 2 $\frac{1}{2}"$ aluminum cap, marked as shown below, 10 inches in the ground, in a hole drilled in bedrock, from which:

NEW BEARING OBJECTS:

A 5/8" x 15" iron pin bears North 44° 48' East, a distance of 16.26 feet, with a 1 $\frac{1}{2}$ "

aluminum cap marked BGB SURVEYOR NE RP.
A 5/8" x 15" iron pin bears South 51° 23' East, a distance of 35.80 feet, with a 1 ½"

aluminum cap marked BGB SURVEYOR SE RP.
A 15" Ponderosa Pine bears South 17° West, a distance of 107.55 feet, marked 1/4 S15 BT.

A 10" Ponderosa Pine bears North 73° West, a distance of 135.65 feet, marked 1/4 S15 BT.

I set a steel fencepost approximately 1 foot North of the corner monument. Corner falls in Southwest corner of rock jack.

I hereby certify that the corner was monumented on October 29, 2015.

Witness: Thomas J. Kopp


UNION COUNTY SURVEYOR	
Date Received 11215	
Date Filed 11/2/15	
Filed By	
File Number 165-7015 R	

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010

JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

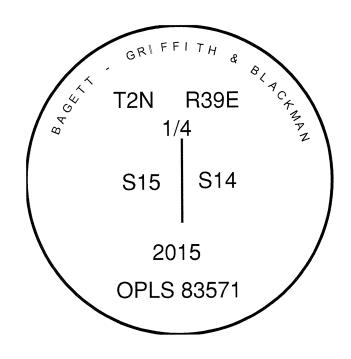

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 15° East declination. The distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees. Basis of bearing to iron pin accessories is as per Survey Number 065-2015.