


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Rufus S. Moore under GLO contract number 382, dated March 23rd, 1881. GLO record states:
 Set post for 1/4 Sec. Cor., from which:
 A fir 16 in. diam. bears N13°E, 15 lks. dist.
 A fir 16 in. diam. bears West 13 lks. dist.

T 2 N R 39 E P-01

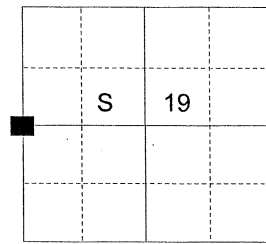

DESCRIPTION OF CORNER EVIDENCE FOUND:

None

SEE SURVEY 024-2013

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position, I set a 2 1/2"x30" aluminum pipe monument with 2 1/2" aluminum cap, marked as shown below, 28 inches in the ground, in a collar or stone 1 ft. diam., from which:

- A 17 inch Douglas Fir bears North 43° East, a distance of 19.90 feet, marked 1/4 S19 BT.
- A 9 inch White Fir bears South 1° East, a distance of 23.80 feet, marked 1/4 S19 BT.
- A 16 inch Douglas Fir bears South 30° West, a distance of 18.55 feet, marked 1/4 S24 BT.
- An 11 inch Douglas Fir bears North 20° West, a distance of 48.55 feet, marked 1/4 S24 BT.

I set a steel fence post approximately one foot North of corner monument. I hereby certify that the corner was monumented on May 15, 2013.


REGISTERED
PROFESSIONAL
LAND SURVEYOR

Jeffrey S. HSU
OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2015

**UNION COUNTY
SURVEYOR**

Date Received 6/3/13
 Date Filed 6/3/13
 Filed By MSG
 File Number 412-2013R

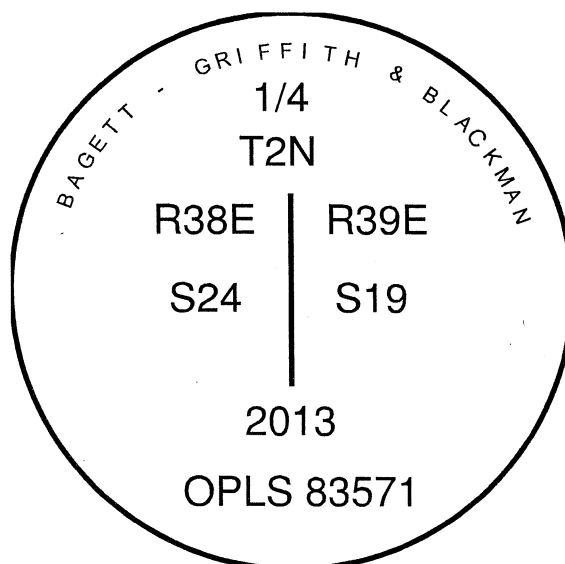

I used a steel tape and magnetic compass in the establishment of the accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing tree.