
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established.

## T 2 N R 39 E T-15

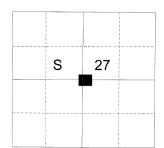

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 025-2014

## DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 2 1/2" x 30" aluminum pipe, 20 inches in the ground, with 2  $\frac{1}{2}$ " aluminum cap marked as shown below, in a mound of stone, 2 ft. diam., from which:

A 6 inch Ponderosa Pine bears North 50° East, a distance of 17.40 feet, marked C1/4 S27 BT. A 15 inch Ponderosa Pine bears South 58° East, a distance of 43.10 feet, marked C1/4 S27 BT. A 5 inch Douglas Fir bears West, a distance of 20.15 feet, marked X BT.

A 9 inch Ponderosa Pine bears North 15° West, a distance of 17.50 feet, marked C1/4 S27 BT.


Set a steel fencepost approximately 1 foot North of corner monument. I hereby certify that the corner was monumented on August 28, 2014.

Witness: Thomas J. Kopp

UNION COUNTY

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2015

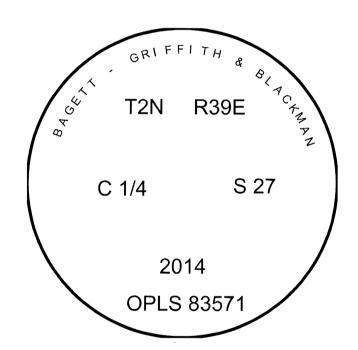

I used a steel tape and magnetic compass in the establishment of the accessories. I used 16° East declination. The distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the bearing trees.