

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

East 1/4 corner, Section 12, T2N, R39E, W.M., Union County, Oregon common corner with the West 1/4 corner, Section 7, T2N, R40E, W.M., Union County, Oregon

Original corner established in 1864 by T. Davenport under contract No. 102 approved 1/12/1864. He set a post from which:  
A Pine 10" diameter bears S67°E, 8 Lks. distance  
A Pine 16" diameter bears N70°W, 14 Lks. distance




Description of corner evidence found:

No original corner evidence found. A stump hole with badly decayed wood at the original location for the Section 12 bearing tree was found.

Description of monument and accessories I established to perpetuate the original location of this corner:

I set a 5/8"x30" iron rod with a 1-1/2 inch aluminum cap marked: at S70°E, 9.24' from the above described original evidence.

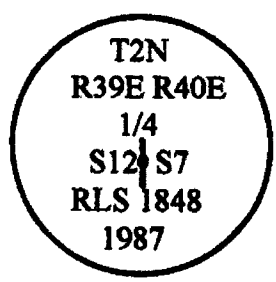

I established the following references:

- A 9" Ponderosa Pine bears S70°30'E, 17.7' blazed & scribed (1/4S7BT)
- A 12" Ponderosa Pine bears S03°15'W, 15.8' blazed & scribed (1/4S12BT)

Office of the \_\_\_\_\_ County Surveyor \_\_\_\_\_ County of \_\_\_\_\_ Union

State of Oregon, I hereby certify that the within instrument was filed in this office

for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19 \_\_\_\_\_

\_\_\_\_\_  
(COUNTY OFFICIAL) by \_\_\_\_\_ (DEPUTY)

UNION COUNTY SURVEYOR  
Date Received 9/16/86  
Date Filed 10/5/86  
By [Signature]  
File No. 095-1996C