

Retracement-Resurvey of the South Boundary

Original Umatilla Indian Reservation

Chains

the ground, for 65½ Mile Cor., with brass cap marked

T2SR34E
UIR
65½M
1917

from which

A tamarack, 6 ins. diam., bears N.43°E. 18 lks. dist.,
blazes healed over. (old B.T.)

A tamarack, 8 ins. diam., bears S.57°E., 9 lks. dist.,
blazes healed over (old B.T.)

Thence

N.89°52'E. on a true line, on 66th Mile

Along gradual N. slope.

55.00 Top of steep descent, bears NW. and SE.; an irregular
fence extends N. and E.

Descend 400 ft. to

76.65 Dry gulch, course NE.

The 68 Mile Cor., heretofore described.

Land, mountainous.

Soil, light loam, shallow, 2nd rate.

Timber, pine and fir.

Undergrowth, fir, pine and willow.

From the 66 Mile Cor.

West, retracing the 67th Mile

39.99 Pass 9 lks. S. of the 66½ Mile Cor., hereinafter described.

80.26 Fall 15 lks. S. of the 67 Mile Cor., the position of

which is determined by the original bearing trees. at
exact cor. point

Set an iron post, 3 ft. long, 2 ins. diam., 10 ins. in the
ground, in mound of stone, 3 ft. base, 1 ft. high, with
brass cap marked

T2SR34E
UIR
67M
1917

from which

A fir, 16 ins. diam., bears N.61°15'E., 118 lks.

UNION COUNTY	
SURVEYOR	
Date Received	3/11/13
Date Filed	3/11/13
By	<i>[Signature]</i> DEPUTY
File No.	271-2013R

704

Retracement-Resurvey of the South Boundary
Original Umatilla Indian Reservation

Chains

dist., marked U I R 67 M B T (old B.T.)

A fir, 24 ins. diam., bears S.61°E., 21 lks. dist.,
marked U I R 67 M B T (old B.T.)

A fir, 20 ins. diam., bears N.23°W., 58 lks. dist.,
blazes healed over (old B.T.)

A pine, 22 ins. diam., bears N.45°30'W., 86 lks.
dist., marked U I R 67 M B T (old B.T.)

S.89°55'E., resurveying the 67th Mile

Over heavily rolling land, through scattering timber.

34.13 Intersect the closing cor. of secs. 31 and 32, which is
an old post in place, marks illegible. At exact cor.
point

Set a basalt stone, 18x12x10 ins., 12 ins. in the ground,
marked C C U R on N., 31 on W., 32 on E., in a ring of
stone; from which

A pine, 40 ins. diam., bears N.22°E., 120 lks. dist.,
marked U R C C B T. I mark additionally, T 2 S R
34 E S 32 (Lower blaze healed over and not opened).

A pine, 24 ins. diam., bears N.56°45'W., 77 lks. dist.,
marked U R C C B T. I mark additionally, T 2 S R
34 E S 31 (Lower blaze healed over and not opened).

36.20 Wood road, bears N. and S.

40.27 Intersect the 66½ Mile Cor., which is an old post, much
decayed, marks illegible. At the exact cor. point

Set an iron post, 3 ft. long, 2 ins. diam., 24 ins. in the
ground, for 66½ Mile Cor., with brass cap marked

T2SR34E
UIR
66½M
1917

from which

A fir, 16 ins. diam., bears S.47°30'E., 42 lks.
dist., marked U R ½ M B T (old B.T.)

A fir, 10 ins. diam., bears N.74°30'E., 16 lks.
dist., marked U R ½ M B T (old B.T.)

UNION COUNTY
SURVEYOR

Date Received 3/11/13

Date Filed 5/11/13

By [Signature] DEPUTY


File No. 271-2013R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. M. P. 67

History of original corner establishment:

Corner was recovered by L. Wilkes, survey group No. 38, in October, 1917. Surveyor General's notes state:
"Set an iron post, 3 ft. long, 2 ins. diam., 10 ins. in the ground, in mound of stone, 3 ft. base, 1 ft. high, with brass cap marked:
from which:
A fir, 16 ins. diam., bears N61°15'E, 118 lks. dist., marked UIR 67M BT (old BT).
A fir, 24 ins. diam., bears S61°E, 21 lks. dist., marked UIR 67M BT (old BT).
A fir 20 ins. diam., bears N23°W, 58 lks. dist., blazes healed over (old BT).
A pine, 22 ins. diam., bears N45°30'W, 86 lks. dist., marked UIR 67M BT (old BT)."

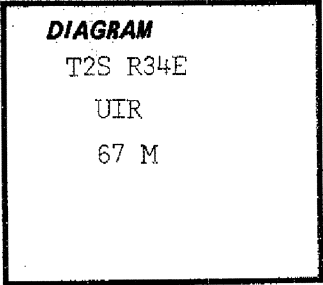

Description of corner evidence found:

Found 2" iron pipe with brass cap marked:
Pipe straight, but loose. Firmed up with 6" X 36" mound of earth and mound of stone around to cap. Cap projects 20" above the ground. From which by magnetic declination of N20°E: A down and rotten pine bears N45°E, 56.6 ft. A 24" fir bears N62°E, 78.1 ft. with grown over blazes. A 40" fir bears S61°E, 15.4 ft. with grown over blazes. No trace of 20" fir that bears N23°W, 58 links. Painted 6" red band around BTs. Placed 54-3s and 54-4s. Placed 54-2 and 54-4 on a steel fence post 5' east of the corner.

T2S R34E
UIR
67 M
1917

Description of monument and accessories I established to perpetuate the original location of this corner:

I hereby certify that the above monument was recovered by me and the above work done to perpetuate the original evidence.

Witnesses: Daniel Rowland
Doug Moser
Ron Gilroy

November 6, 1980

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Barry B. Barbour

OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1051

UNION COUNTY SURVEYOR
Date Received _____
Date Filed _____
By _____
NARRATIVE DRAWING 1/3
File No. _____

REFER TO SURVEY 10-81

Office of... County Surveyor... County of... Union...
State of... Oregon... I hereby certify that the within instrument was filed in this office
for record on the... 30th day of... January... 1981.

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

UNION COUNTY SURVEYOR
☆ GPO—798-276
Date Received 3/12/13
Date Filed 3/12/13
By [Signature] DEPUTY
File No. 279-2013R