


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. N-13

History of original corner establishment:

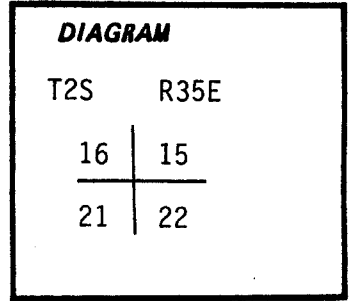

In 1882 under GLO Contract No. 451, Rufus S. Moore set a post 4 ft. long, 4 ins. square, 24 ins. in ground for cor. to secs. 15, 16, 21 & 22 marked T2S R35E S16 on NW, T2S R35E S16 on NW, S21 on SW and S22 on SE faces with 3 notches on S and E edges. From which:

- A Fir 7" dia. bears N34°E 61 lks. dist., marked T2S R35E S15 BT.
- A Fir 14" dia. bears N5°W 61 lks. dist., marked T2S R35E S16 BT.
- A Fir 5" dia. bears S56°W 36 lks. dist. marked T2S R35E S21 BT.
- A Fir 9" dia. bears S13°E 65 lks. dist., marked T2S R35E S22 BT.


Description of corner evidence found:

Found a Doug. Fir 24" dia. with open blazes with visible axe marks. No scribing visible due to face of blaze having been burnt at one time. Tree is in good condition for NW BT. BT blaze is 3' above ground. A Douglas Fir 16" dia. with open blaze and visible scribing "T2S R35E S1". BT portion of blaze is 3 ft. above ground. Tree is in good condition for NE BT. A Doug. Fir 17" dia. with chopped open blaze to visible scribing "S2" for S.E. BT. Tree is in good condition. Remains of a Doug. Fir stump 2.3 ft. high with traces of blaze scar but no scribing visible for SW BT.

No evidence of original post could be found.

Description of monument and accessories established to perpetuate the original location of this corner:

Record distances from the faces of the N.E., N.W., & S.W. BT's match very good to a common point and if 56 lks. is used for the S.E. BT instead of 65 lks., then it matches to the same point. This established point also fits record bearings pretty good. At this established point, set 2½"x30" galvanized pipe with brass cap stamped:

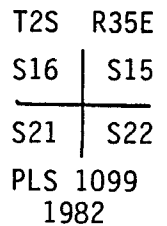

Set pipe 24" in ground with mound of stone & dirt to cap.

- From which: The found N.W. BT previously described bears N6°W, 40.25 ft.
- The found N.E. BT previously described bears N34°E, 40.25 ft.
- The found S.E. BT previously described bears S14°E, 37.0 ft.
- The found S.W. BT stump previously described bears S52°W, 23.75 ft.

New BT: A Douglas Fir 7" dia. bears S4°W 12.8 ft., scribed T2S R35E S21 BT.

Painted blazes and attached signs per Standard Specifications for Cadastral Surveys, USFS Region 6, Oct., 1979.

Corner falls just east of east edge of large clearing 1 foot north of E-W fence and 650 ft. east of dirt road.

Compass Declination: 18½° E

I hereby certify the above described corner monument and/or accessories was established as described on July 28, 1982.

Witnesses: Rodger Orton
G. Orton

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Gary L. Langlitz
OREGON
JULY 22, 1977
GARY L. LANGLITZ
1099

Office of.....Surveyor..... County of..... Union.....

State of.....Oregon....., I hereby certify that the within instrument was filed in this office

for record on the...4... day of...OCTOBER....., 1982

.....Howard L. Perry..... by *Gary L. Langlitz*.....
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR	
Date Received _____	
☆ GPO 799-509	
Date Filed _____	
By _____	
File No. <u>201-84 R</u>	