


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. P-19


History of original corner establishment:  
Not established during original survey

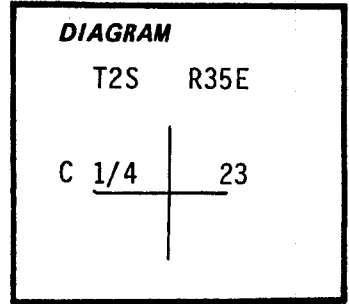

Description of corner evidence found:  
None

Description of monument and accessories established to perpetuate the original location of this corner:  
Corner location determined by survey and subdivision of Section 23.

At surveyed point: Set 2 1/2" x 30" galvanized pipe with brass cap attached 24" in the ground stamped:

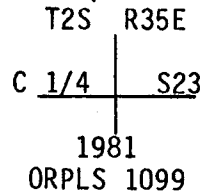

From which:

An 8" White Fir bears S88°E 6.0 ft. scribed C 1/4 S 23 BT.

A 16" Tamarack bears N65° W 19.9 ft. scribed C 1/4 S 23 BT.

Attached 54-3 and 54-4 signs to BT's. Painted blazes red and 6" ring around BT's. Attached brass washers LS 1099 to foot blazes. Set metal fence post 5' north of corner with 54-4 and 54-9 signs.

Corner falls on level ground on the south edge of clear cut with large Tamarack.

Compass Declination: 18 1/2°

I hereby certify the above described corner monument and/or accessories was established as described on November 9, 1981.

Witnesses: Loren Huntsman  
Millard Wyatt



Office of.....Surveyor..... County of.....Union.....  
 State of.....Oregon..... I hereby certify that the within instrument was filed in this office  
 for record on the...4... day of...OCTOBER....., 1982  
 Howard L. Perry by *Gary L. Langlitz*  
 (COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY SURVEYOR**

Date Received \_\_\_\_\_

Date Filed 10-7-82

By \_\_\_\_\_

File No. 213-84 R