


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. R-15

History of original corner establishment:

John A. Hurlbert in 1874 under G.L.O. contract No. 201 set a Pine post 4 ft. long 3" thick 2' in the ground for 1/4 Sec. Cor. from which:

- A Pine 24" in dia. bears S19°W 54 lks.
- A Pine 12" in dia. bears N15°E 110 lks.

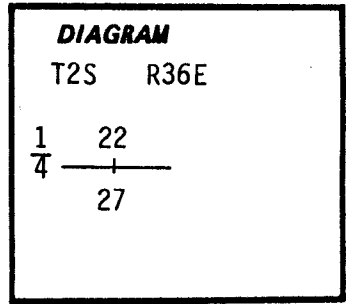

Description of corner evidence found:

The original N.E. bearing tree, a found 22" Ponderosa Pine alive with opened blaze and visible scribing " /4". At location of corner found remains of rotted Pine post. No signs of SW BT, which falls in a power line right-of-way.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the true corner point established by reference to the original NE bearing tree, we set a 2 1/2" by 30" galvanized pipe 20" in the ground with 3" brass cap stamped:

- From which: A Pine 12" dia. bears N 31°E 81.6 ft. scribed "1/4 S 22 BT"
 - A Pine 14" dia. bears S55°E 46.2 feet scribed 1/4 S27 BT.
- Painted blazes and 6" band around trees red. Attached 54-4 and 54-3 signs to both BT's. Attached brass washer stamped LS 1099 to foot blaze of both BT's. Attached 54-4 sign to metal fence post set 6' West of corner.

T2S R36E

S22

PLS 1099

Compass Declination: 18 1/2° E

I hereby certify the above described corner monument and/or accessories was established as described on June 17, 1981.

Witnesses: Glen Wagoner
Millard Wyatt

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Gary L. Langlitz

OREGON
JULY 22, 1977
GARY L. LANGLITZ
1099

Office of.....Surveyor..... County of.....Union.....
 State of.....Oregon..... I hereby certify that the within instrument was filed in this office
 for record on the.....4..... day of.....OCTOBER....., 1981.....
Howard L. Perry..... by.....*Gary L. Langlitz*.....
 (COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY
SURVEYOR**

Date Received _____
GPO 799-509

Date Filed _____

By _____

File No. 304-84R