CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by John A. Hurlburt under GLO Contract No. 201, dated August 5, 1873. Surveyor General field notes state:

Set basalt stone 20x15x10 10 in in ground for 1/4 sec cor Pine 24 in dia N44°W 133 lks

No other near

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 22"x16"x10" protruding 8" above ground, firmly set in a collar of stone. No marks found on stone.

See Survey No. 026-2015

T2S R36 E E-11 S 4

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the found stone position, I set a 2 1/2" x 30" aluminum pipe with a 2 ½" aluminum cap marked as shown below, 20" in the ground, with mound of stone 3 foot to top of cap. From which:

NEW BEARING OBJECTS:

A 19" Ponderosa Pine bears North 3° East, a distance of 28.20 feet, marked 1/4 S4 BT.

A 19" Ponderosa Pine bears South 87° East, a distance of 53.35 feet, marked 1/4 S9 BT. A 15" Ponderosa Pine bears South 54° West, a distance of 89.95 feet, marked 1/4 S9 BT. A 10" Ponderosa Pine bears North 70° West, a distance of 93.90 feet, marked 1/4 S4 BT.


Buried stone along West side of pipe monument.


I set a steel fence post approximately 1 foot North of corner monument.

I hereby certify that the corner was monumented on April 28, 2015.

REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2017

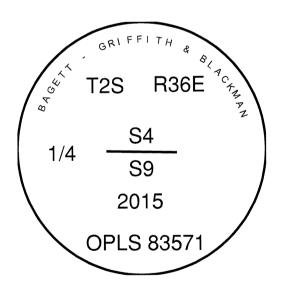

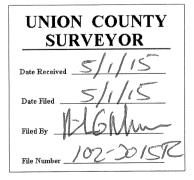

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.