Index 'File No	CORNER RECO	ORD (SEARCH) Tract or	Cor. SE corner
T —28 R. — 36E	R,D. La Crande	SM 7151.4) Survey No County <u>Union</u>	No. sec. 12
Merid. <u>W111</u>	N. F	State Oregon	
CORNER DIAGRAM	DESCRIBE CORNER MON	UMENT FOUND	
PHOTO IDENTIFICATION DATA Photo No. ENW 2 205 Filed At.	DESCRIBE BEARING TREE Found BT pine This could ref	s OR OTHER OFFICIAL ACCESSORIES Fi snag 24" in diameter, not t er to T25 R37E	ound too ledgible.
Object Ident. Ident. By Signature 7	Corner can be	ION RELATIVE TO NEAR-BY FEATURES, driven too on road through	ALSO HOW TO REACH CORNER Private land.
PLANE COORDINATE POSITION DATA State Zone X Y	Refer to aeria Open, grassy,	l photos.	
Estab. By		(最重要是)额表示。	
Signature Dewey Flowers	Title Divis	2,100,2400,1010,1	Date 7100-52 (3/68)

UNION COUNTY SURVEYOR

Date Received

Date Filed 12-16-87

BY G. LANGLITZ, DEPUTY

File No. 182 183-87R

J-25


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John A. Hurlburt under GLO contract number 201, dated August 5, 1873. Surveyor General

record states:
Set basalt stone 15x12x10-8 in. in ground for cor to secs 7-18-12 and 13.
Pine 18 in. dia. S60°E 50 lks
Pine 18 in. dia. N53°E 68 lks
Pine 24 in. dia. N5°W 163 lks

Corner later found by Henry Meldrum under GLO contract 450 dated June 11, 1882. Mr. Meldrum set new corners for the township to the East of the range line. His notes state: Destroyed marks referring to Secs. 18 and 7.

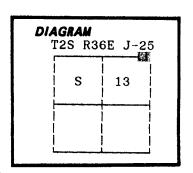

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found a stone 15x9x8 inches loose on ground with no identifiable marks.

Found a 20 inch diameter Ponderosa Pine stump N53°E, 68 links rotted with no scribes visible.

Found a 18 inch diameter Ponderosa Pine stump S60°E, 50 links rotted with no scribes visible.

Found a 24 inch diameter Ponderosa Pine stump N5°W, 163 links rotted with no marks visible.

UNION COUNTY SURVEYOR		
Date Received Z-13-89		
Date Filed Z-13-89		
BY G. LANGLIZ, DEPUTY		
File No. 37-89 R		

Description of monument and accessories I established to perpetuate the

original location of this corner: In place of stone, and at record bearing and distance from the bearing tree stumps, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown, in the ground, from which:

A 10 inch diameter Ponderosa Pine bears S33°W, 9.43 feet marked T2S R36E S13 BT A 8 inch diameter Ponderosa Pine bears N66°W, 25.78 feet marked T2S R36E S12 BT


Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet North with land survey monument sign attached.

Buried the original corner stone North and alongside of monument.

I hereby certify that the above corner point was perpetuated as hereon described on November 15, 1988.

Witnesses: Rick Robinson and Jeff Petersen.

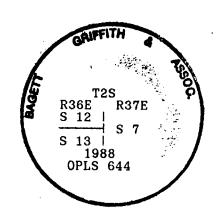

	PROFESSIONAL LAND SURVEYOR	
Ž	In I Siff	, ~
	OREGON JULY 10, 1984 DUANE I. GRIFFITH	
•		

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

J-25

Office of	County of
State of , I hereby certify th	et the within instrument was filed in this office
for record on the day of	, 19
by	
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)