

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


Index File No. L-1

History of original corner establishment:

In 1874, J. Hurlburt under GLO Contract No. 201
Set a Tamarack post, 4 ft. long, 3 ins. thick, 2 ft.
in the ground for 1/4 Sec. Cor.

Pine 10 in. dia. S32° W 15 lks.

Pine 8 in. dia. S 62° E 36 lks.

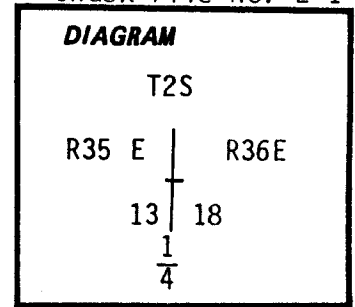

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner:

Corner location determined by survey and single proportionate measurement along West boundary of Section 18:

At surveyed point:

Set 2 1/2" x 30" galvanized pipe with brass cap attached 24" in the ground stamped:

From which:

A 15" Douglas Fir bears N 7 W 40.9 ft. scribed 1/4 S 13 BT.

An 8" Tamarack bears S35 E 21.3'

Scribed 1/4 S 18 BT

Attached 54-3 and 54-4 signs to BT's. Painted blazes and 6" red ring around BT's.

Attached brass washers LS 1099 to foot blazes. Set metal post 5" north of corner with 54-4 sign. Corner falls on west slope 160' south of E-W draw and 495 ft. west of dirt road.

Compass Declination: 18 1/2° East

I hereby certify the above described corner monument and/or accessories was established as described on November 17, 1981.

Witnesses: Loren Huntsman Millard Wyatt
Jeff Anderson Greg Orton

T2S
1/4
R35E | R36E
S13 | S18
1981
OR PLS 1099

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Gary L. Langlitz
OREGON
JULY 22, 1977
GARY L. LANGLITZ
1099

Office of..... Surveyor..... County of..... Union.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the... 4... day of... OCTOBER... 1982...
..... Howard L. Perry..... by *Gary L. Langlitz*.....
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received _____

★ GPO—798-276

Filed _____

By _____

File No. 253-84R