

Index File No. N-3

History of original corner establishment:

In 1874, John A. Hurlburt, under GLO contract No. 201, set a Fir post 4 ft. long 3" thick 2 feet in the ground for 1/4 Sec. from which:

A Tamarack 12" dia. bears N31°W 81 lks.

A Tamarack 8" dia. bears S27° 41 lks.


Remonumentation by B.L.M., 1975:

The 1/4 Sec. Cor. of Secs. 18 and 19, determined at record bearing and distance from the remains of the original bearing trees:

A root hole, bears S. 27° W., 41 lks. dist., with a down and decayed western larch stump alongside, 12 ins. diam., no marks visible.

A root hole, bears N. 31° W., 81 lks. dist., with a down and decayed western larch snag alongside, 18 ins. diam., with scribe marks BT visible on decayed blaze.

(cont'd next page)

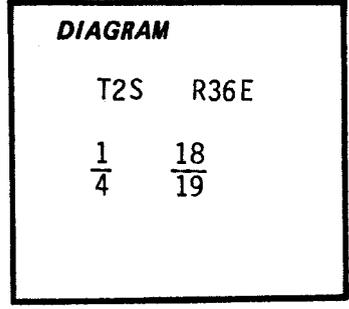

Description of corner evidence found:

FOUND: 2 1/2" Iron Pipe with BLM brass cap stamped set 24" in the ground. T2S R36E

A well decayed Tamarack log with illegible scribing visible bears N31°W 53.5 ft. No sign could be found of the SW original BT. $\frac{1}{4}$ S18 S19 1975

A D. Fir 13" dia. bears S15° W 23.0 ft. scribed 1/4 S19 BT (BLM 1975).

A Lodgepole Pine, dead, 10" dia. bears N64°E 40.3 ft. scribed 1/4 S18 BT (BLM 1975).

Description of monument and accessories established to perpetuate the original location of this corner:

We mark a new bearing tree as follows:

A Tamarack 8" dia. bears N 34° E 33.2 ft. scribed 1/4 S18 BT.


Attached brass washer marked "LS 1099" to lower blaze. Attached signs and painted BT's per Standard Specifications for Cadastral Survey, U.S.F.S. Region 6, October, 1979.

Placed steel post approx. 5 ft. N and E of monument with 54-2 and 54-4 signs attached.

Compass Declination: 18 1/2° East.

I hereby certify the above described corner monument and/or accessories was established as described on June 23, 1981.

Witnesses: Glen Wagoner
Loren Huntsman

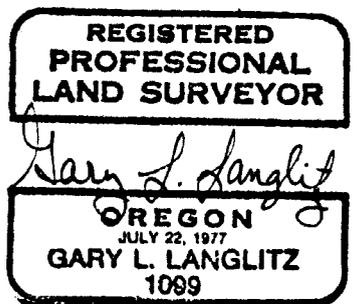

Office of..... Surveyor..... County of..... Union.....
 State of..... Oregon....., I hereby certify that the within instrument was filed in this office
 for record on the..... 4..... day of..... OCTOBER....., 1981
 Howard L. Perry..... by *Gary L. Langlitz*
 (COUNTY OFFICIAL)..... (DEPUTY)

UNION COUNTY SURVEYOR	
Date Received	_____
Date Filed	_____
By	_____
File No.	<u>267-84 R</u>

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: (Cont'd)

At the corner point

Set an iron post, 28 ins. long, 2 1/2 ins. diam. 24 ins. in the ground, with brass cap mkd.

T 2 S R 36 E
 S18
1/4 S19
 1975

from which new bearing trees

A Pine, 10 ins. diam., bears N. 64 1/2° E., 61 1/2 lks. dist., mkd. 1/4 S18 BT.

A Fir, 12 ins. diam., bears S. 15° W., 35 lks. dist., mkd. 1/4 S19 BT.

Description of corner evidence found:

Description of monument and accessories I established to perpetuate the original location of this corner:

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR	
Date Received	788-278
Date Filed	_____
By	_____
File No.	267-B4B

Remonumentation of Certain Original Corner Points,
T. 2 S. R. 36 E., Willamette National Forest

CHAINS

A pine, 27 ins. diam., bears N. $31\frac{1}{2}^{\circ}$ W., 104 lks.
dist., mkd. $\frac{1}{4}$ S17 BT.

Deposit corner stone alongside iron post.

The $\frac{1}{4}$ sec. cor. of secs. 18 and 19, determined at record
bearing and distance from the remains of the original
bearing trees:

A root hole, bears S. 27° W., 41 lks. dist., with
a down and decayed western larch stump alongside,
12 ins. diam., no marks visible.

A root hole, bears N. 31° W., 81 lks. dist., with
a down and decayed western larch snag alongside,
18 ins. diam., with scribe marks BT visible on
decayed blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T 2 S R 36 E
 $\frac{1}{4}$ S 18
S 19
1975

from which new bearing trees

A pine, 10 ins. diam., bears N. $64\frac{1}{2}^{\circ}$ E., $61\frac{1}{2}$ lks.
dist., mkd. $\frac{1}{4}$ S18 BT.

A fir, 12 ins. diam., bears S. 15° W., 35 lks.
dist., mkd. $\frac{1}{4}$ S19 BT.

(Remonumenting corners established by Manius Buchanan,
Deputy Surveyor, in 1895)

The $\frac{1}{4}$ sec. cor. of secs. 17 and 18, determined at record
distance from the original bearing trees:

A pine, 11 ins. diam., bears S. 86° E., 32 lks.
dist., with healed blaze. (Record, S. 81° E.)

A pine, 11 ins. diam., bears N. 54° W., $32\frac{1}{2}$ lks.
dist., with scribe marks $\frac{1}{4}$ S BT visible on
partially healed blaze.

At the corner point

Set an iron post, 28 ins. long, $2\frac{1}{2}$ ins. diam., 24 ins.
in the ground, with brass cap mkd.

T 2 S R 36 E
 $\frac{1}{4}$ S 18 | S 17
1975

The $\frac{1}{4}$ sec. cor. of secs. 8 and 17, determined at record
bearing and distance from the remains of the original
bearing trees:

UNION COUNTY
SURVEYOR

Date Received

3/15/13

Date Filed

3/15/13

By

J. L. DEPUTY

File No.

342-20132

T2S36N03

T2S36 N03

T2S36 L05