

12-70A


10

CERTIFIED RECORD OF CORNER MONUMENTATION

R-7

History of original corner establishment:

Corner established by General Land Office Contract survey.  
The original notes state;  
39.70 ch set pine post 4' long 3" thick, 2' in ground  
for  $\frac{1}{4}$  corner.  
From which;  
Pine 12" in diam bears North 3 lks dist. marked  $\frac{1}{4}$ SBT;  
Pine 6" in diam bears S31°E 28 lks dist marked  $\frac{1}{4}$ SBT;

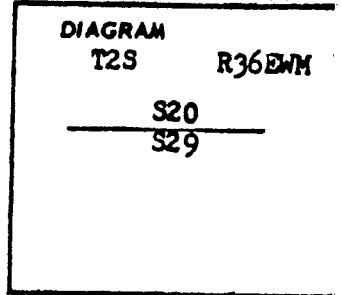


Description of corner evidence found:

Found mound of stone  
In section 29 found slab with scribe

Description of monument and accessories I established to perpetuate the original location of this corner

At the position of the corner I set a 30" galvanized pipe with an eight inch plate welded to bottom and a bronze cap on top. The hole was back filled with stone and tamped soil.

I stamped the disk

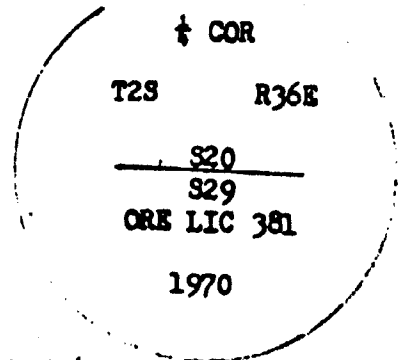

From the monument the original bearing trees were (none)  
I established the following new bearing trees;  
Red Fir 7" in diam bears N30°E at a distance of 29.6 ft  
scribed  $\frac{1}{4}$ SBT;  
Red Fir 11" in diam bears S75°W at a distance of 22 ft. scribed  $\frac{1}{4}$ SBT;  
The distance measured to center of respective trees on level.  
I placed bearing tree signs on both old and new bearing trees and painted  
a stripe around the trees. I placed a steel fence post with USFS sign  
54-4 attached. USFS sign 54-4 attached to post indicating USFS land to southeast.

Office of County Surveyor County of Union  
State of Oregon, I hereby certify that the within instrument was filed in this office  
for record on the 23 day of July, 1970, at 1 o'clock P.M. (signed)  
County Surveyor by James D. [Signature]  
(COUNTY OFFICIAL) (DEPUTY)

|                              |  |
|------------------------------|--|
| <b>UNION COUNTY SURVEYOR</b> |  |
| Date Received _____          |  |
| Date Filed _____             |  |
| By _____                     |  |
| File No. <u>299-84R</u>      |  |