


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally established by John A. Hurlburt under GLO contract number 201, dated August 5, 1873. Surveyor General record states:

Set pine post 4 ft. long 3 in. thick 2 ft. in ground for 1/4 sec. cor.
 Pine 15 in. dia. S70°W 53 lks
 Tamarack 10 in. dia. N66°E 24 lks

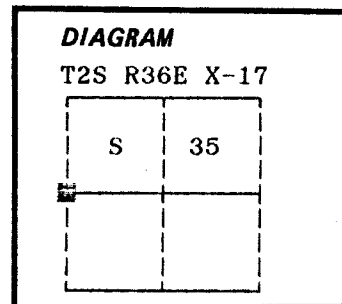

No record of subsequent monumentation found in Union County survey records.

Description of corner evidence found:

Found no evidence of the original corner.

See map of survey dated June, 1989.

UNION COUNTY SURVEYOR	
Date Received	<u>8-22-89</u>
Date Filed	<u>8-22-89</u>
By	<u>G. LANGRISH DEPUTY</u>
File No.	<u>153-89 R</u>

Description of monument and accessories established to perpetuate the

original location of this corner: At position determined by survey, I set a 2 1/2" x 30" aluminum pipe with aluminum cap marked as shown, 28 inches in the ground, from which:

New Bearing Trees:


A 14 inch diameter Western Larch bears S33°E, 26.63 feet marked 1/4 S35 BT
 A 8 inch diameter Ponderosa Pine bears S77°W, 19.95 feet marked 1/4 S34 BT

Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet South with land survey monument sign attached.

I hereby certify that the above corner point was perpetuated as hereon described on May 5, 1989.

Witness: Rick Robinson

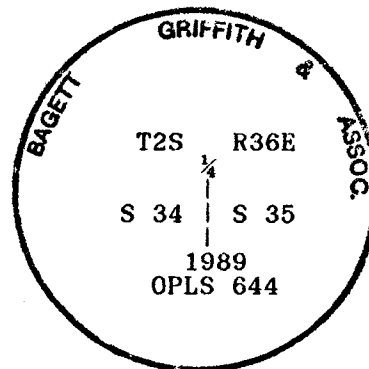

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

OREGON
 JULY 19, 1964
DUANE I. GRIFFITH
 644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of..... County of.....
 State of....., I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL) (DEPUTY)