

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

J-17


History of original corner establishment:

Corner established by Henry Meldrum under GLO contract no 450 dated June 11, 1882

Surveyor General records state:


Set stone 16 x 9 x 6 ins 11 ins in ground for cor to secs 10, 11, 14 & 15 marked with 4 notches on S and 2 on E edges 300 ft below 1/4 corner from which;

- A pine 20 ins diam bears S 74° W, 27 lks dist marked S 15 BT
- A pine 30 ins diam bears N 40° W, 52 lks dist marked R 37 E S 10 BT
- A pine 24 ins diam bears N 30° E, 15 lks dist marked T 2 S S 11 BT
- A pine 30 ins diam bears S 23° E, 72 lks dist marked S 14 BT

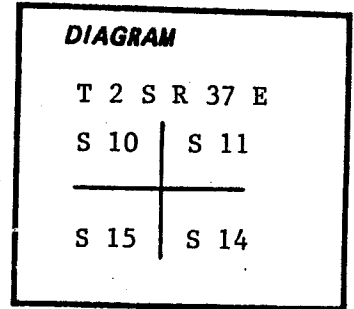

Description of corner evidence found:

At approximate corner position found a 3 inch brass cap on a 2 inch iron pipe projecting 4 inches out of the ground in old rock mound marked thus: T 2 S R 37 E WM

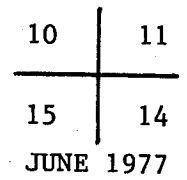

- A burned stump for Section 14 bearing tree.
- A burned root hole for Section 15 bearing tree.
- A root hole for Section 10 bearing tree.
- No trace of Section 11 bearing tree.

APA

NOTE: A tree fence corner bears S 08° E, 40 feet dist from which the fence lines run South, East and West.

Description of monument and accessories established to perpetuate the original location of this corner:

Erected surrounding rock mound around existing corner monument and set a 6 foot steel fence post alongside with a sign 54-4 attached.

New bearing trees established:

- A pine 14 ins diam bears N 29° W, 50.4 ft dist marked T 2 S R 37 E S 10 BT
- A pine 15 ins diam bears N 74° E 45.7 ft dist marked T 2 S R 37 E S 11 BT
- A pine 10 ins diam bears S 74° E, 46.0 ft dist marked T 2 S R 37 E S 14 BT
- A pine 12 ins diam bears S 70° W, 38.0 ft dist marked T 2 S R 37 E S 15 BT

Each new bearing tree has a sign 54-3 attached below a 6 inch band of red paint and has a brass washer marked PLS 1639 nailed flush with BT blaze. A sign 54-4 is attached on the opposite side of tree from BT blaze.

To the remains of the original record accessories attached signs 54-3 and 54-4 and painted with red paint.

I hereby certify that the above described corner monument was maintained to Forest Service standards by me on Oct. 28, 1983.

REGISTERED PROFESSIONAL LAND SURVEYOR

*William L. Hanley*

OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1639

Office of..... County Surveyor..... County of..... Union.....  
State of..... Oregon..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

(COUNTY OFFICIAL)

by

(DEPUTY)

UNION COUNTY SURVEYOR

Date Received 276 11-10-83

Date Filed 11-14-83

By G. LANGLITZ, DEPUTY

File No. 392-83 R