CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by Henry Meldrum under GLO contract no. 450 dated June 11, 1882.

Surveyors General records state:

Set basalt stone $18 \times 9 \times 7$ ins 12 ins in the ground for $\frac{1}{4}$ Sec Cor marked 1/4 on W face, from which;

A pine 50 ins diam bears N 73° W, 47 lks dist marked 1/4 S BT. A pine 10 ins diam bears N 63° E, 36 lks dist marked 1/4 S BT.

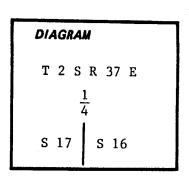

Description of corner evidence found:

Found a sawed pine stump 50 ins diam for section 17 bearing tree with typical axe marks below where tree was sawed.

Found a pine 20 ins diam with previously opened blaze with portion of 1 and all of S scribe marks. The remaining record scribes were removed when blaze was opened by others. This tree is rotten in the middle and has 5 inches of overgrowth.

At record position determined by original bearing trees and official record notes found a mound of stone. One of the stones measures $18 \times 9 \times 7$, however, no marks were found.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a $2\frac{1}{2}$ inch aluminum cap on a 2 inch aluminum pipe 30 inches long 17 inches in the ground to bedrock with 13 inches projecting out of the ground with a surrounding rock mound and a 6 foot long steel fence post alongside with a sign 54-4 attached. Stone of proper size placed in surrounding rock mound.

Aluminum cap marked thus:

T 2 S R 37 E $\frac{1}{4}$ S 17 \bullet S 16 1983

ORLS 1639

New bearing trees:

A pine 8 inches diam bears S 56° E, 17.0 feet dist and marked 1/4 S 16 BT. A pine 14 inches diam bears S 32° W, 13.6 feet dist and marked 1/4 S 17 BT.

Each new bearing tree has a sign 54-3 nailed below a 6 inch band of red paint and a brass washer marked PLS 1639 nailed flush with BT blaze and a sign 54-4 nailed on opposite side of BT blaze.

The original BT stump and tree have signs 54-3 and 54-4 attached and a 6 inch band of red paint identically to new bearing trees.

I hereby certify that the above corner monument was properly established by me on Aug. 31, 1983 and witnessed by Jim DeMastus.

REGISTERED PROFESSIONAL LAND SURVEYOR

benastus.		
Office of County Surveyor County	of	William L Hanley
State ofOregon, I hereby certify that the wi	ithin instrument was filed in this offic	JULY 14, 1978
(COUNTY OFFICIAL)	1	WILLIAM L. HANLEY 1639
_		

Form R6-7100-57 (9/71)

eceived 9-6-83 # GPO-798-276

By G. LANGLITZ DEPUTY