


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:  
 Corner not previously established.

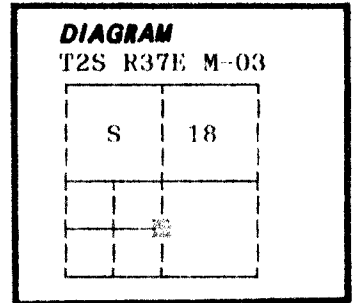

No record of subsequent monumentation found in Union County survey records.

**Description of corner evidence found:**

Corner not previously established  
 see map of survey dated November, 1989.

**Description of monument and accessories I established to perpetuate the**

**original location of this corner:** At position determined by survey, I set a 2½" x 30" aluminum pipe with aluminum cap marked as shown, 24 inches in the ground, from which:

- New Bearing Trees:  
 A 11 inch diameter Ponderosa Pine bears S37°E, 61.9 feet marked CS1/16 S18 BT  
 A 10 inch diameter Douglas Fir bears N83°W, 38.13 feet marked CS1/16 S18 BT


Painted a 6 inch red band around all BTs and attached bearing tree and land survey monument signs.

Set a steel fencepost approximately 5 feet South with land survey monument and property boundary signs attached.

Raised a mound of stone around monument, 3 ft. base to top of cap.

I hereby certify that the above corner point was perpetuated as hereon described on October 26, 1989.

Witnesses: Rick Robinson and Jeff Petersen

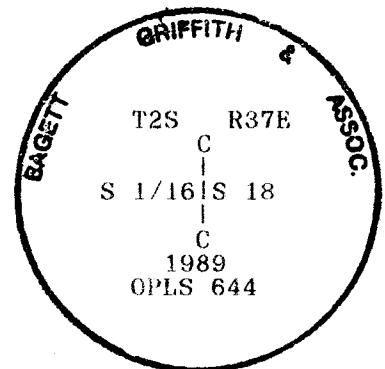

**REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR**

OREGON  
 JULY 10, 1964  
**DUANE I. GRIFFITH**  
 644

I used a steel tape and magnetic compass in the establishment of new accessories. I used 17° East magnetic declination and the distances are to a 50d spike driven in the right side of the root crown. I attached a brass washer marked OPLS 644 to the BT blaze.

Office of..... County of.....  
 State of..... I hereby certify that the within instrument was filed in this office  
 for record on the..... day of.....

**UNION COUNTY  
 SURVEYOR**

---

Date Received 12-27-89  
 Date 12-27-89  
 By R. ROBINSON DEPUTY  
 File 260-89R

Form R6-7100-57 (9/71)

\*GPO-591-971, 1988