


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Henry Meldrum under GLO contract no. 450 dated June 11, 1882.

Surveyor General records state:

Set basalt stone 14 x 9 x 7 ins 10 ins in the ground for Cor to Secs 16, 17, 20 & 21 marked with 3 notches on S and 4 on E edges from which;

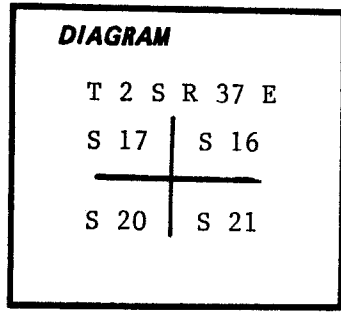

- A tamarack 20 ins diam bears S 14° E, 12 lks dist marked S 21 BT.
- A pine 50 ins diam bears N 77° E, 42 lks dist marked T 2 S S 16 BT.
- A tamarack 24 ins diam bears N 68° W, 23 lks dist marked R 37 E S 17 BT.
- A fir 18 ins diam bears S 68° W, 15 lks dist marked S 20 BT.


Description of corner evidence found:

- A standing dead fir 24 ins diam for section 20 bearing tree with healed blaze and wooden fence post nailed over BT blaze.
- A swaed pine stump 50 ins diam for section 16 bearing tree. No marks identified except for typical axe marks below where tree was sawed.
- A root hloe for section 21 bearing tree.
- A rotted stump for section 17 bearing tree.
- Found a stone 12 x 8 x 7 ins loose and alongside mound with 3 notches on one face and 2 notches on another identified.

Description of monument and accessories | established to perpetuate the original location of this corner:

Set a 2½ inch brass cap on a 2 inch galvanized iron pipe 31 inches long 25 inches in the ground and projecting 6 inches out of the ground with a surrounding rock mound and a 6 foot steel fence post alongside with a sign 54-4 attached. Buried original stone on north side of monument.

Brass cap marked thus:

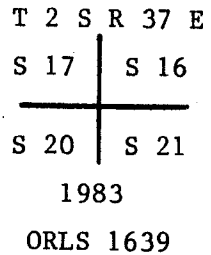

New bearing trees:

- A tamarack 9 ins diam bears N 27° W, 46.0 feet dist marked T 2 S R 37 E S 17 BT.
- A fir 11 ins diam bears N 04° E, 32.2 feet dist marked T 2 S R 37 E S 16 BT.
- A fir 13 ins diam bears S 48° W, 31.5 feet dist marked T 2 S R 37 E S 20 BT.
- A fir 13 ins diam bears S 38° E, 59.2 feet dist marked T 2 S R 37 E S 21 BT.

Each new bearing tree has a sign 54-3 nailed below a 6 inch band of red paint and a brass washer marked PLS 1639 nailed flush with BT blaze with a sign 54-4 nailed on opposite side of tree from BT blaze.

I hereby certify that the above described corner monument was properly established by me on Aug. 29, 1983 and witnessed by Jim DeMastus.

Office of..... County Surveyor..... County of..... Union.....  
 State of..... Oregon....., I hereby certify that the within instrument was filed in this office  
 for record on the..... day of....., 19.....  
 by.....  
 (COUNTY OFFICIAL)

**REGISTERED  
 PROFESSIONAL  
 LAND SURVEYOR**

*William L Hanley*

**OREGON  
 JULY 14, 1978  
 WILLIAM L. HANLEY  
 1639**

**UNION COUNTY  
 SURVEYOR**  
 (DEPUTY)  
 Date Received 9-6-83  
 Date Filed 9-12-83  
 By G. LANGUITZ DEPUTY  
 File No. 333-83 R