UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established Herman D. Gradon, under GLO Contract No. 452, dated March 31, 1882. Surveyor General record states: Set basalt stone 17x11x4 marked 1/4 for corner, from which:

A fir 17 ins diam, bears $S65^{\circ}E$, 32 lks dist marked 1/4S BT

A fir 6 ins diam, bears $S75^{\circ}W$, 15 lks dist marked 1/4S BT

No record of subsequent monumentation found in the Union County monumentation records

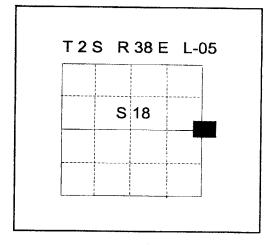

DESCRIPTION OF CORNER EVIDENCE FOUND:

No evidence found of original corner monument or its' accessories Survey Number 87--79 established a position for the 1/4 corner, but set no monument.

See Survey Number 042-2001

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position of the 1/4 corner established by survey number 87-79, I set a $2\frac{1}{2}$ " x 30" aluminum pipe with aluminum cap marked as shown below, 36" in the ground, from which;

NEW BEARING TREES:

A 13" diameter Douglas Fir bears North 81° East, a distance of 25.95 feet marked X BT.

A 13" diameter Douglas Fir bears South 46° East, a distance of 87.50 feet, marked 1/4 S17 BT.

A 11" diameter White Fir bears South 59° West, a distance of 100.20 feet, marked 1/4 S18 BT.

A 9" diameter Ponderosa Pine bears North 50° West, a distance of 103.85 feet, marked 1/4 S18 BT.


I hereby certify that the corner was monumented on November 1, 2001. Witness: Norbert W. Volny and Gregory T. Blackman Jr.

REGISTERED PROFESSIONAL LAND SURVEYOR

OREGON July 17, 1986

RICK G. ROBINSON 2219

Renewal Date December 31, 2002

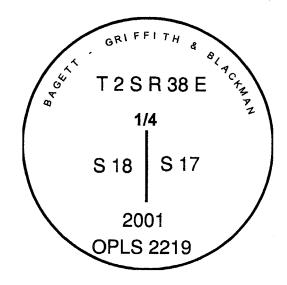

UNION COUNTY SURVEYOR

Date Received 41/29/01

Data Filed 12/05/6/

File Number 047- 2001 R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 18° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing tree. I attached a brass washer marked OPLS 2219 to the BT blaze.

HORIZONTAL CONTROL DATA

UNION COUNTY, OREGON OREGON STATE PLANE, NORTH ZONE (3601)

STA NAME:

200518

1/4 SECTION CORNER COMMON TO SECTIONS: 17 and 18

TWP.

2 S. RGE. 38 E. GEODETIC COORD: NAD 83(91)

DATE TIED: August 3, 2005

LAT:

45 ° 23 ' 28.088230 " N

SURVEYOR: RICK G. ROBINSON

LONG:

118 ° 5 '

48.39298 " W

OPLS 2219

FIRM: BAGETT, GRIFFITH, & BLACKMAN

2006 ADAMS AVENUE

LAGRANDE, OR 97850

(541) 963-6092

SP. COOR: NAD 83(91)

N:

637876.491

INT FT.

E:

8819379.284

INT FT.

TYPE: GPS

THETA:

42 ' 15.5987257 "

ORDER: SECOND CLASS: 1

SCALE FACTOR:

0.9999021007

ELEV:

3620.86

US FT.

ELEV: DATUM: NGVD 29

COMMENTS:

Corner is a 2 ½" aluminum monument in the

Westerly track of a road.

Cap is marked as shown:

T2S R38E 1/4 S 18 S 17 1978 PLS 644

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON RICK G. ROBINSON 2219

Renewal Date: December 31, 2006

1 METER = 3.2808333333... US FEET = 39.37 INCHES

1 METER = 3.280839895 INT'L FEET OR 1 INCH = 2.54 CM

TO CALCULATE ELEVATION FACTOR (IN THE NORTH AMERICAN CONTINENT)

DIVIDE 20,906,000 BY (20,906,000 + ELLIPSOID ELEV. IN FEET)


UNION COUNTY SURVEYOR

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner originally established by Herman D. Gradon, under GLO Contract No. 452, dated March 31, 1882. Surveyor General record

cap marked as shown below, 36" in the ground, from which;

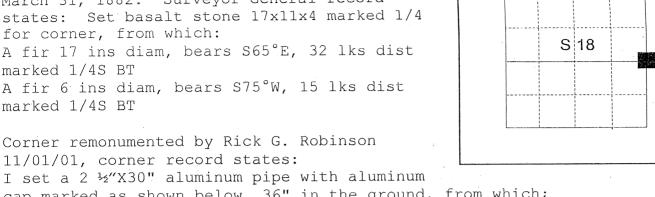

New Bearing Trees:

A 13" diameter douglas fir bears north 81° east, a distance of 25.95 Feet marked X BT.

A 13" diameter douglas fir bears south 46° east, a distance of 87.50 feet, marked 1/4 S17 BT.

A 11" diameter white fir bears south 59° west, a distance of 100.20 feet, marked 1/4 S18 BT.

A 9" diameter ponderosa pine bears north 50° west, a distance of 103.85 feet, marked 1/4 S18 BT.

No record of subsequent monumentation found in the Union County monumentation records

DESCRIPTION OF CORNER EVIDENCE FOUND:

No evidence found of original corner monument or its' accessories Survey Number 87-79 established a position for the 1/4 corner, but set no monument.

Found 2001 corner accessories as stated above, corner monument destroyed.

Description of monument and accessories I established


TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:


At record bearing and distance from 2001 accessories I set a 2 ½"X30" aluminum pipe with aluminum cap marked as shown below, 32" in the ground.

I hereby certify that the corner was monumented on August 30, 2004. Witness: Mike Spicer

REGISTERED **PROFESSIONAL** LAND SURVEYOR 7. 84 OREGON GREGORY T. BLACKMAN 991

Renewal Date: December 31, 2005

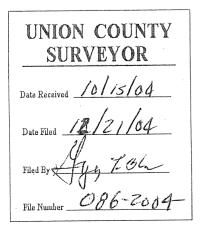

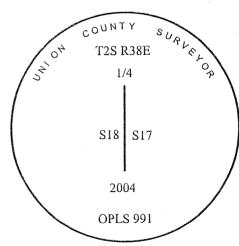

T2S R38E L-05

I used a steel tape and magnetic compass in the retracement of the new accessories. I used 18° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing tree.