


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:
Corner not previously established.

T 2S R 40 E B-01

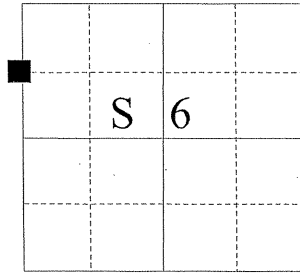

DESCRIPTION OF CORNER EVIDENCE FOUND:
None.

See Survey Number 050-2013

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8" x 30" iron pin with 2 1/2" aluminum cap, marked as shown below, 30 inches in the ground, from which:

A 14 inch White Fir bears North 1° East, a distance of 19.35 feet, marked N1/16 S6 BT.
An 8 inch White Fir bears South 78° West, a distance of 5.45 feet, marked N1/16 S1 BT.


I set a steel fencepost approximately 1 foot East of the corner monument.
I hereby certify that the corner was monumented on October 9, 2013.

REGISTERED
PROFESSIONAL
LAND SURVEYOR



OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2015

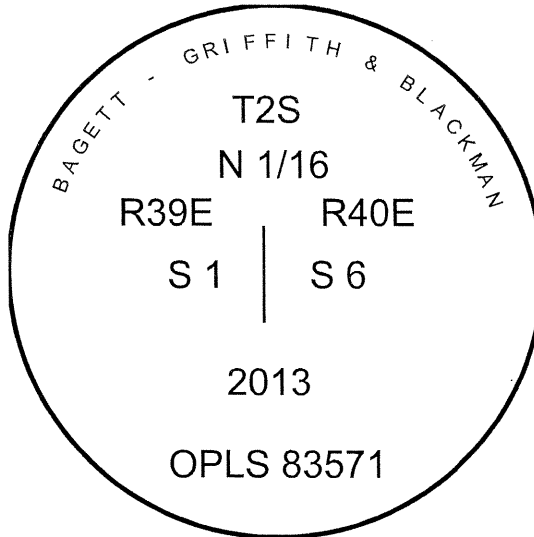

**UNION COUNTY
SURVEYOR**

Date Received 10/10/13

Date Filed 10/10/13

Filed By [Signature]

File Number 444-2013R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 16° East declination. The distances are to a 60d spike in the right hand side of the root crown of the new bearing trees. Bearings are to a brass washer marked OPLS 83571 in the lower BT blaze.