

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


E-15

History of original corner establishment:

Corner established by Henry Meldrum under GLO contract No.450 and dated June 11, 1882.

Surveyor General records state:

Set basalt stone 18 x 10 x 6 in in ground for 1/4 Sec Corner marked 1/4 on N face and raised a mound of stone alongside 40 ft above creek, pits impracticable.

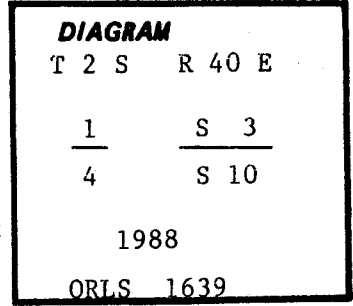

Description of corner evidence found:

Searched 4 man-hours total on 7-07-88 and 7-13-88, for original corner stone on steep hillside below road - area obliterated by falling rocks from road construction. Corner declared lost.

Description of monument and accessories established to perpetuate the original location of this corner:

At position midway between adjacent section corners East & West...

Set 2½" aluminum cap on 2" aluminum pipe 24" in ground & 6" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A white fir 17" diam brs S26°W, 38.4' dist mkd 1/4S10 BT.

A lodgepole pine 11" diam brs N86°W, 7.8' dist mkd 1/4S3 BT.

New BT's have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly reestablished by me and witnessed by Patti Hanley on August 5, 1988.

UNION COUNTY SURVEYOR

Date Received 9-22-88

Date Filed 9-23-88

By G. LANGLITZ, DEPUTY

File No. 135-88 R

REGISTERED PROFESSIONAL LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of..... County Surveyor..... County of..... Union.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)