


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Henry Meldrum under GLO contract No. 450 and dated June 11, 1882. Surveyor General records state: Set a 4' long 4" square post 24" in ground for Cor to Secs 1, 12, 6 & 7 marked T2SS1 on NW, R40ES12 on SW, R41ES7 on SE and S6 on NE with 5 notches on S and 1 on N edges from which: A 6" fir brs N80°E, 20 lks dist mkd S6 BT. A 9" pine brs N45°W, 1 lks dist mkd T2SS1 BT. A 10" pine brs S57°W, 21 lks dist mkd R40ES12 BT. A 7" pine brs S45°E, 11 lks dist mkd R41ES7 BT.

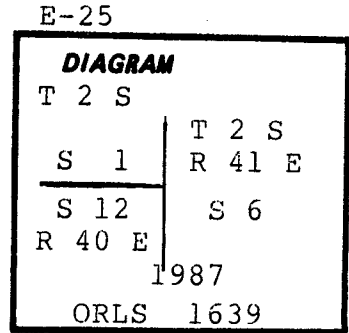

Corner MODIFIED by Alonzo Gesner under GLO contract No. 683 and dated June 07, 1898, and his record states: Cor to Secs 1 and 12 which is a post marked and witnessed as stated by the U.S. Surveyor General and I added T2S on the NW face of post and obliterated the marks on the NE & SE faces. Also obliterated marks on the bearing trees in Secs 6 & 7.

Description of corner evidence found:

Found rotten and burned remains of post to depth of 20" from which:

A spruce 12" dia brs N82°E, 14.3' (record, fir brs N80°E, 20 lks) with axe marks on partially healed blaze. A L.P. pine leaning snag 6" dia brs N31°W, 2.8' (record, N45°W, 1 lk) marked "T2" on rotting blaze.

UNION COUNTY SURVEYOR	
Date Received	<u>8-12-87</u>
Date Filed	<u>8-24-87</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>63-87R</u>

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of found original post...

Set 2½" aluminum cap on 2" aluminum pipe 25" in ground with 5" projecting out of ground with surrounding rock mound and 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A spruce 11" diam brs N52½°W, 10.1' dist mkd T2SR40ES1 BT.
W. fir 11" diam brs S58½°W, 35.4' dist mkd T2SR40ES12 BT.

Each BT has a sign 54-3 and signs 54-4 or 54-9 attached below a 6" band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on July 20, 1987.

Jim DeMastus

REGISTERED PROFESSIONAL LAND SURVEYOR

William L. Hanley

**OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639**

Office of.....County Surveyor..... County of...Union.....
State of.....Oregon..... I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)