CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner originally ESTABLISHED by Henry Meldrum under GLO contract No. 450 and dated June 11, 1882.

Surveyor General records state:

Set post 3 ft long 3 in square 24 in in ground for 1/4 Sec.Cor. marked 1/4 S on W face, from which: A fir 10 in diam bears N83 E, 41 lks dist marked 1/4S BT. A pine 22 in diam bears N22 W, 31 lks dist marked 1/4S BT.


Corner REESTABLISHED by Alonzo Gesner under GLO contract No. 683 dated June 07, 1898, during his resurvey of the east boundary of T.2S., R.40E., W.M.,

The 1/4 Sec.Cor. which had been destroyed & reestablished it as follows: Set pine post 4 ft long 4 ins square 24 inches in the ground marked 1/4S12 on the W face, from which: A fir 10 in diam bears N83 E, 41 lks dist marked 1/4S BT.

A pine 22 in diam bears N22 W, 31 lks dist marked 1/4S BT.

Description of corner evidence found:

Searched 8 man-hours total on 7-21-87, 11-20-87 and 7-19-88 in old logged off area - corner or accessories not found and corner declared lost.

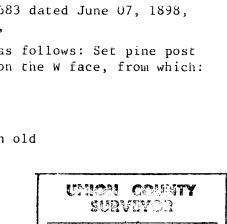

G-25

R 40 E

1/4 S 12

ORLS

DIAGRAM

T 2

1988

S

R 41 E

1639

Description of monument and accessories I established to perpetuate the original location of this corner:

At proportioned position on line between NE and SE corners to section 12...

Set $2\frac{1}{2}$ " aluminum cap on 2" aluminum pipe 22" in ground & 8" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established: A white fir $10^{\prime\prime}$ diam brs 803° W, 23.8^{\prime} dist marked 1/4812 BT. A western larch $10^{\prime\prime}$ diam brs 889° W, 22.8^{\prime} dist marked 1/4812 BT.

New BT's have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 190 East.

I hereby certify that the above described corner monument was properly reestablished by me and witnessed by Patti Hanley on August 11, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR	•
William L. Honler	1
OREGON JULY 19, 1975 WILLIAM L. HANLEY 1639	

Office of County Surveyor	County of Union		
State of Oregon I hereby certify that the within instrument was filed in this office			
for record on the day of			
(COUNTY OFFICIAL)	(DEBLITY)		