


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner was originally established under GLO contract number No. 102, dated July 20th, 1863, executed by Timothy W. Davenport. Surveyor General field notes state:

Set qr. sec. post, made mound of Earth and drove charred stake as per inst.

T 2 S R 40 E L-1

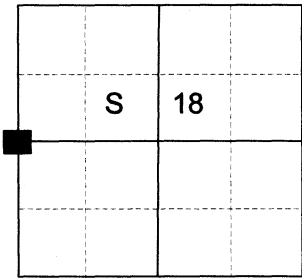

DESCRIPTION OF CORNER EVIDENCE FOUND:

None. A North/South fence line falls ± 10 feet East.


SEE SURVEY NUMBER 037-2026

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position by Survey I set a 2 ½"x30" aluminum pipe, 44" in the ground, with a 3" aluminum cap marked as shown below, from which:

NEW BEARING OBJECTS:


- A 5/8"x30" iron pin bears North 37°42' East, a distance of 14.55 feet, with a 1 ½" aluminum cap marked "BGB SURVEY MARKER NE RP".
- A 5/8"x30" iron pin bears South 31°40' East, a distance of 16.44 feet, with a 1 ½" aluminum cap marked "BGB SURVEY MARKER SE RP".
- A 5/8"x30" iron pin bears South 38°04' West, a distance of 10.10 feet, with a 1 ½" aluminum cap marked "BGB SURVEY MARKER SW RP".
- A 5/8"x30" iron pin bears North 25°28' West, a distance of 12.61 feet, with a 1 ½" aluminum cap marked "BGB SURVEY MARKER NW RP".

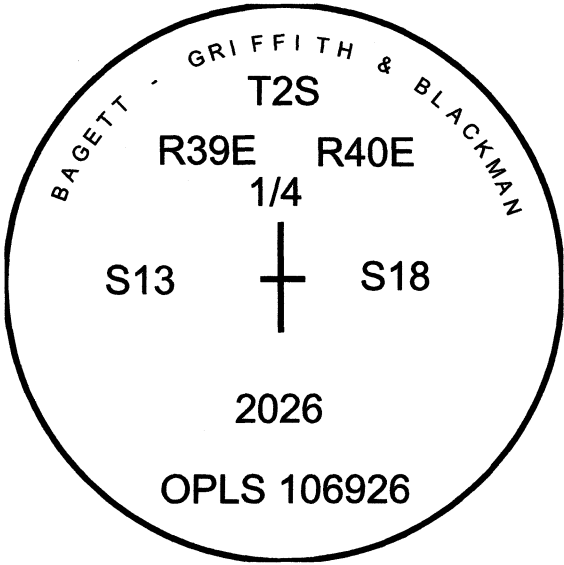

I hereby certify that the corner was monumented on August 28th, 2026

Witness: Kyle Tucker

REGISTERED
PROFESSIONAL
LAND SURVEYOR

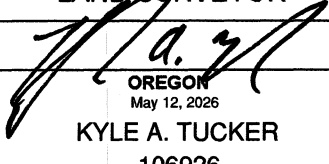
OREGON
May 12, 2026
KYLE A. TUCKER
106926


Renewal Date: June 30, 2028

I used a Leica GS 18 with RTK in the establishment of the new bearing objects. Basis of bearing is as per map of survey number 037-2026. Bearings and distances are measured to the center of the aluminum caps.

UNION COUNTY
SURVEYOR

Date Received 9/29/26

Date Filed 9/29/26

Filed By 

File Number 043-2026R