

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**


N-17

**History of original corner establishment:**

Corner established by Henry Meldrum under GLO Contract no. 450 dated June 11, 1882, and his record states:

Set post 4 ft long 4 ins square 24 ins in ground for Cor. to Sec. 14, 15, 22 & 23 marked: T 2 S S 14 on NE, R 40 S 15 on NW, S 22 on SW and S 23 on SE with 3 notches S and 2 notches on E edge, from which:

- A pine 10 ins diam bears N59°W, 57 lks dist marked R40ES15 BT.
- A pine 12 ins diam bears N5°E, 74 lks dist marked T2SS14 BT.
- A tamarack 18 ins diam bears S67°W, 101 lks dist marked S22 BT.
- A fir 7 ins diam bears S55°E, 39 lks dist marked S28 BT.

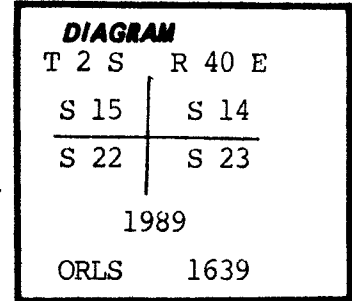

**Description of corner evidence found:**

None. Corner reestablished by proportionate measurement from survey control.

Corner search area is on edge of old wildfire and has been logged - several rotten stumps and down and rotten trees - area dominated with dense alder brush.

**Description of monument and accessories established to perpetuate the original location of this corner:**

At proportioned position determined from recovered controlling adjacent section corners N, S, E & W by survey control...

Set a 2" x 30" aluminum pipe with 2½" aluminum cap 25" in ground & projecting 5" out of ground with surrounding earth mound & placed 6' steel fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram. No stones available for mound.

**New bearing trees established:**

- Spruce 17" dia brs N52½°W, 77.0' mkd T24R40ES15 BT.
- Spruce 25" dia brs N14½°E, 55.5' mkd T2SR40ES14 BT.
- Spruce 17" dia brs S64°E, 45.3' mkd T2SR40ES23 BT.
- Western larch 15" dia brs S78 3/4°W, 36.8' mkd T2SR40ES22 BT.

New bearing trees have a brass washer marked PLS 1639 nailed flush to face of blaze. Attached signs 54-3 & 54-9 & painted face of blaze & a 6' band of red around each bearing tree.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly established by me & witnessed by F.S. Munro on September 26, 1989.

**REGISTERED PROFESSIONAL LAND SURVEYOR**

*William L. Hanley*

OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1639

Office of... County Surveyor..... County of... Union  
State of... Oregon..... I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19...  
..... by .....  
(COUNTY OFFICIAL)

**UNION COUNTY SURVEYOR (DEPUTY)**  
Date Received 3-12-90  
Date Filed 3-12-90  
By [Signature]  
File No. 17-90R

N-17