


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

N-25

**History of original corner establishment:**

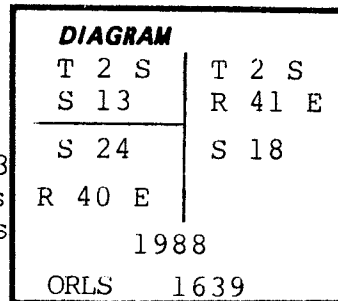

Corner originally ESTABLISHED by Henry Meldrum under GLO contract No.450, dated June 11,1882. Surveyor General records state: Set post 4 ft long 4 in square 24 in in ground for Cor to Secs 13,24,18 & 19 marked T2SR40ES13 on NW, R40ES24 on SW, S19 on SE and R41ES18 on NE with 3 notches on S and N edges, from which: A fir 6 in diam brs N53°E, 16 lks dist mkd R41ES18 BT. A fir 20 in diam brs N46°W, 19 lks dist mkd T2SR40ES13 BT. A fir 16 in diam brs S77°W, 20 lks dist mkd T24 BT. A fir 14 in diam brs S15°E, 4 lks dist mkd S19 BT.

Corner MODIFIED by Alonzo Gesner under GLO contract No.683, dated June 7,1898, during his resurvey of the east boundary of T2SR40E,WM...The Cor to Secs 13 & 24 which is a post 3 ft above ground 2 in square mkd & witnessed as stated by U.S.Surveyor General. I obliterated marks on the NE and SE faces of post and marked the NW face T2S. Destroyed marks on the bearing trees to Secs 18 and 19.

**Description of corner evidence found:**

Found burned and rotten wood to a depth of 18" for original corner post.

A white fir 30" dia mkd "13" inside healed blaze with 6" overgrowth opened this date brs N46°W, 19 lks dist per record from corner post remains. A white fir 20" dia with fully healed blaze brs S77°W, 20 lks dist per record from corner post remains. No trace of other two original BTs obliterated by Alonzo Gesner in 1898.

<b>UNION COUNTY SURVEYOR</b>
Date Received <u>6-8-89</u>
Date Filed <u>6-9-89</u>
By <u>G. LANGRITZ, DEPUTY</u>
File No. <u>116-89R</u>

**Description of monument and accessories I established to perpetuate the original location of this corner:**

At position of original wood post remains...

Set 2½" aluminum cap on 2" x 30" aluminum pipe 24" in ground to bedrock & surrounded with mound of earth & stone. Set 6' steel fence post alongside corner with sign 54-9 attached. Cap marked as shown in corner diagram.

**New bearing tree established:**

A white fir 19" diam brs N22½°W, 27.9' dist mkd T2SR40ES13 BT.

New bearing trees have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above corner monument was properly REMONUMENTED to U.S.F.S. standards by me on August 16, 1988 and witnessed by Jim DeMastus.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William L. Hanley*

OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1639

Office of..... County Surveyor..... County of..... Union.....  
State of..... Oregon....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)