


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:
Corner not previously established.

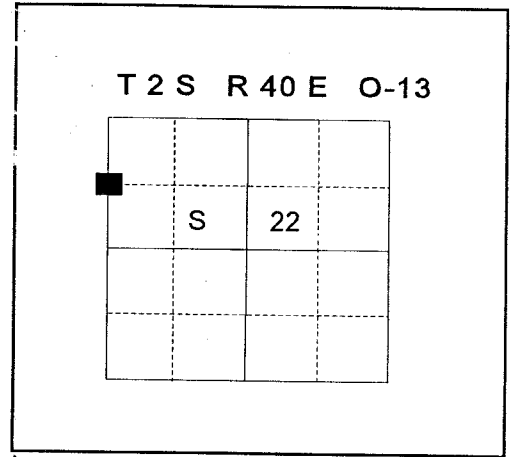

No record of monumentation found in UNION COUNTY survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

Corner not previously established.

See Survey Number 029-1997.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At the position determined by said survey, I set a 2 1/2" x 30" aluminum pipe with 2 1/2" aluminum cap marked as shown below, 20" in the ground, from which:

NEW BEARING TREES:

A 20" diameter Ponderosa Pine bears N 2°E, a distance of 27.80 feet, marked N 1/16 S22 BT.

A 12" diameter Ponderosa Pine bears S 53°W, a distance of 48.97 feet, marked N 1/16 S21 BT.

Raised a mound of stone around monument, 3 ft. base to top of cap.
Set steel fence post approximately 2 feet East of monument.

Corner falls in remains of an old North-South fence, approximately 20 feet North of an East-West blaze line.

I hereby certify that the corner was monumented on September 4, 1997.


Witness: Jeff Madsen

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Rick G. Robinson

OREGON
July 17, 1986
RICK G. ROBINSON
2219

Renewal Date December 31, 1998

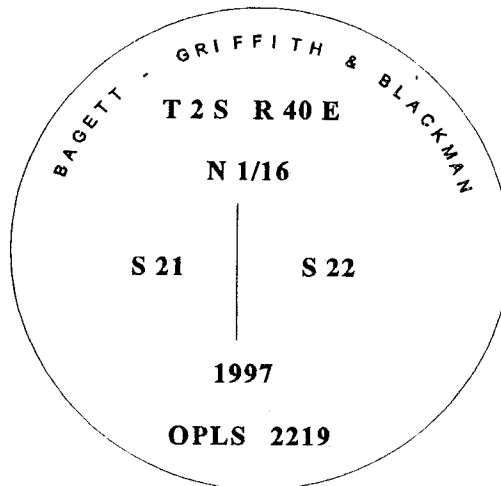

I used a steel tape and magnetic compass in the establishment of new accessories. The magnetic declination used was 18° East. The distance to the bearing trees is to a 50d spike driven on the right side of the tree at the root crown. I attached a brass washer marked OPLS 2219 to the BT blaze.

**UNION COUNTY
SURVEYOR**

Date Received 9-9-97

Date Filed 9-13-97

Filed By *Mary T. Blair*

File Number 026-1997R