
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by Henry Meldrum under GLO Contract no. 450 dated June 11, 1882, and his record states:

A post 3 ft long 3 ins square 24 ins in ground for 1/4 Sec. Cor marked 1/4 S on W face, from which:

A pine 18 in diam bears $N89^{\circ}W$, 224 lks dist marked 1/4 S BT. A pine 18 in diam bears $S85^{\circ}E$, 100 lks dist marked 1/4 S BT.

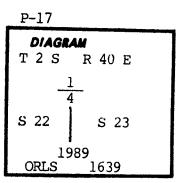

Description of corner evidence found:

None. Corner reestablished by proportionate measurement from survey control.

Corner search area is in area of old wildfire and dense alder brush and recent logging activity - no trees older than 30 years.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position midway between adjacent section corners north and south...

Set a 2" x 30" aluminum pipe with $2\frac{1}{2}$ " aluminum cap 24" in ground & projecting 6" out of ground with surrounding earth mound & placed 6' steel fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram. No stones available for mound.

New bearing trees established: White fir 8" dia brs $S75\frac{1}{2}$ E, 27.2' dist mkd 1/4 S23 BT. Lodgepole pine 6" dia brs $S30\frac{1}{2}$ W, 28.4' dist mkd 1/4 S22 BT.

New bearing trees have a brass washer marked PLS 1639 nailed flush to face of blaze. Attached signs 54-3 & 54-9 & painted face of blaze & a 6' band of red around each bearing tree.

Compass declination 190 East.

I hereby certify that the above described corner monument was properly established by me & witnessed by F.S. Munro on October 02, 1989.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Howley
OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of County Surveyor County of Ur State of Oregon , I hereby certify that the within ins		
for record on the day of	UNION COUNTY	
Form R6-7100-57 (9/71)	Data Received 3-12-30	•GPO-591-971, 1988
	Date Filed 3-12-90	

P-11