

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner ESTABLISHED by Daniel Thompson under GLO Contract No.103 dated September 03, 1863, and his record states:

Set post for corner to Secs 21, 22, 27 & 28 in mound of stone.

Corner RECOVERED by Henry Meldrum under GLO Contract No. 450 dated June 11, 1882 and his record states:

The corner to Secs 21, 22, 27 & 28 which is a post 4 ft long 4 ins square marked S27 on SE, R40E S22 on NE, T2S S21 on NW and S28 on SW with 2 notches on S and 3 on E edges with mound of stone around post.

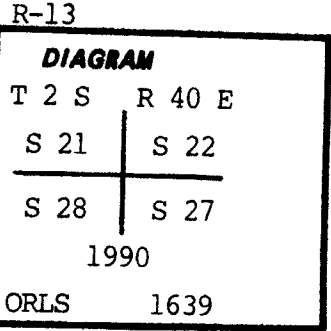

Description of corner evidence found:

Found rock mound with old post remnants in remains of very old and long used East-West fence line and in line with very old and long used fence line South - accepted center of rock mound as true corner point. NOTE: The existing fence line South of this point turns westerly following lower part of very steep hillside and corners at a point approximately 5 chains west of corner point as a convenience to fence line maintenance.

Description of monument and accessories I established to perpetuate the original location of this corner:

At position in center of recovered rock mound described above...

Set a 2" x 30" aluminum pipe with 2½" aluminum cap 24" in ground & projecting 6" out of ground with surrounding stone mound & placed 6' steel fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram.

There being no trees within limits the following bearing objects were established:
 A basalt boulder 18"x12" projecting 12" out of ground brs N02½°E, 58.8' dist mkd BXO.
 A basalt boulder 23"x19" projecting 11" out of ground brs S73½°W, 30.6' dist mkd BXO.
 A basalt boulder 23"x19" projecting 15" out of ground brs N43°W, 68.3' dist mkd BXO.
 There being no other suitable bearing objects available I set a 5/8"x30" rebar reference monument with 1½" aluminum cap which brs S45°E, 18.8' dist. Aluminum cap marked as shown below with arrow pointing towards the corner monument & sign 54-3 attached to the rebar reference monument.


Compass declination 19° East.

I hereby certify that the above described corner monument was properly established by me & witnessed by Patricia M. Hanley on February 02, 1990.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

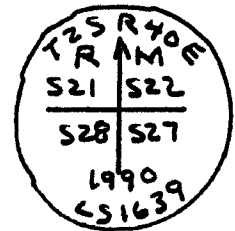

Office of...County..Surveyor..... County of...Union.....
 State of...Oregon..... I hereby certify that the within instrument was filed in this office
 for record on the..... day of....., 19.....
 by
 (COUNTY OFFICIAL)

UNION COUNTY SURVEYOR	
Date Received	<u>3-12-90</u>
Date Filed	<u>3-12-90</u>
By	<u>Henry T. Blaker</u>
File No.	<u>21-90R</u>

GPO: 1989-692-049