

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


R-17

History of original corner establishment:

Corner established by Henry Meldrum under GLO Contract No.450 dated June 11,1882.

Surveyor General records state:

Top of hill brs N and S and set post 4 ft long 4 in square 24 ins in ground for Cor to Secs 22,23,26 & 27 marked T2SS 23 on NE, R40ES22 on NW, S27 on SW and S26 on SE with 2 notches on S and E edges from which:
Pine 5 in diam bears N80°W, 37 lks dist marked R40ES22 BT.
Pine 7 in diam bears N12°E, 28 lks dist marked T2SS23 BT.
Pine 10 in diam bears S3°W, 67 lks dist marked S27 BT.
Pine 3 in diam bears S28°E, 66 lks dist marked S26 BT.

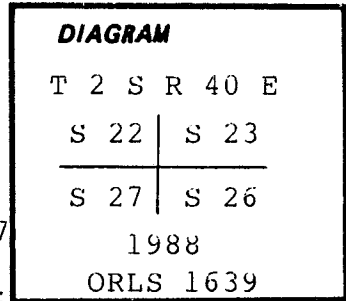

Description of corner evidence found:

Found a burned and rotten post remains of original post from which: A lodgepole snag 8" diam mkd "S26 BT" on open double blaze brs S28°E, 66 lks per record. A ponderosa pine 27" diam with healed double blaze brs N12°E, 28 lks dist per record. A lodgepole snag 15" diam with chaining notch on pitched over face inside 6" overgrowth opened this date brs N80°W, 37 lks dist per record. No trace of section 27 BT.

UNION COUNTY SURVEYOR

Date Received 6-8-89

Date Filed 6-9-89

By G. LANGLITZ, DEPUTY

File No. 118-89 R

Description of monument and accessories I established to perpetuate the original location of this corner:

At position of recovered post remains... Set 2 1/2" aluminum cap on 2" aluminum pipe 25" in ground & 5" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-2 & 54-9 attached. Cap marked as shown in corner diagram.

New bearing trees established:

A western larch 16" diam brs N63 1/2°W, 63.5 ft dist mkd T2SR40ES22 BT.
A ponderosa pine 13" diam brs S29°W, 46.2 ft dist mkd T2SR40ES27 BT.
A ponderosa pine 21" diam brs S17°E, 56.5 ft dist mkd T2SR40ES26 BT.

New bearing trees have a brass washer stamped PLS 1639 nailed to face of blaze. Attached signs 54-3 & 54-9 and painted face of blaze and 6" band of red around each BT.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented to U.S.F.S. standards by me on September 28, 1988.

REGISTERED PROFESSIONAL LAND SURVEYOR

William L. Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of County Surveyor County of Union
State of Oregon, I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)