## CERTIFIED RECORD OF LAND CORNER MONUMENTATION


## History of original corner establishment:

Corner ESTABLISHED by W. B. Barr under GLO Contract No. 355 dated June 14, 1880, and his record states:

Set basalt stone 16 x 10 x 8 ins in ground for 1/4 Sec.

Cor. marked 1/4 on W face, from which:

A fir 24 ins diam bears S58°W, 64 lks dist marked 1/4 S BT. A willow 4 ins diam bears S56°E, 10 lks dist marked 1/4 S BT.

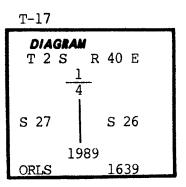

## Description of corner evidence found:

Found stone 16  $\times$  10  $\times$  6 ins on lower side of a 15" diam white fir which has grown out of a rock mound surrounding the corner stone. The center of said white fir is the true corner point, from which:

A rotting fir stub 8° high 27° diam (less bark) mkd 1/4S on small rottinglichen covered face - this tree died shortly after scribing - brs S58°W, 66 lks dist per record.

Note: Upon return to this corner for remonumentation the previously recovered bearing tree stub had fallen down-hill and is mostly deteriorated - the blaze which had pitched over is still intact & barely legible.

## Description of monument and accessories I established to perpetuate the original location of this corner:

At position of found stone mound in center of white fir...

The 15" diam white fir was felled & the stump cut flush with ground level. A 5/8" x 30" rebar was driven through the center of sawed stump flush with the top & a  $1\frac{1}{2}$ " diam aluminum cap attached to rebar mkd as shown in corner diagram. A substantial rock mound was constructed around stump.

New bearing trees established: White fir 21" dia brs S23 $^{\circ}$ W, 42.1' dist mkd 1/4 S27 BT. White fir 14" dia brs S69 $^{10}$ E, 18.9' dist mkd 1/4 S 26 BT.

New bearing trees have a brass washer marked PLS 1639 nailed flush to face of blaze. Attached signs 54-3 & 54-9 & painted face of blaze & a 6' band of red around each bearing tree. Original BT remains painted red with signs 54-3 and 54-9 attached.

Compass declination 190 East.

I hereby certify that the above described corner monument was properly established by me & witnessed by F.S. Munro on August 03, 1989.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

WILLIAM L. HANLEY
1639

Office of County Surveyor County of Un	ion	
State of Oregon I hereby certify that the within inst		т
for record on the day of by	UNION COUNTY SURVEYOR	
(COUNTY OFFICIAL)	(DEPUTY)	
Form R6-7100-57 (9/71)		•GPO-591-971, 1988
	Date Filed 3-12-90	

T-17