

Index File No. V-19
T 2 S R. 40E
Merid. Will.


CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

R.D. Union County Union
N.F. W-W State Oregon

Tract or Survey No. _____ Cor. No. _____

CORNER DIAGRAM

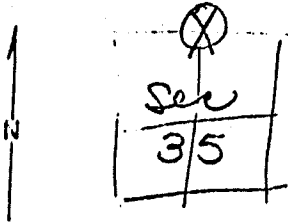

DESCRIBE CORNER MONUMENT FOUND

Basalt Stone: 24x18x5. flat to ground in fair condition marked: 4 on top.
This stone has slid down the hill (SE) some 15-20'

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

I believe I have the proper fir tree tagged as the B.T. A 24" D.F. has fallen across the cor. pt. (or near it.) + helped no doubt to move the cor. pt. out of place.

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature _____

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency _____

Signature John Mitchell

Title Surveyor Division (Contractor)

Headquarters _____

Date 7/11/80

FS-7100-52 (3/68)

UNION COUNTY SURVEYOR
Date Received _____
Date Filed 12-18-87
By G. LANGUITZ, DEPUTY
File No. 217-87R

V-19

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-19


History of original corner establishment:

Corner established by Henry Meldrum under GLO contract No. 450 and dated June 11, 1882.

Surveyor General records state:

Set basalt stone 24 x 18 x 5 ins in stoney ground impossible to set stone in ground and piled stone around same - marked 1/4 on N face and raised mound of stone alongside, pits impracticable from which:

A fir 20 in dia brs N53°W, 29 lks dist marked 1/4S BT. At foot of precipice bears N & S and faces E about 20 ft in height.

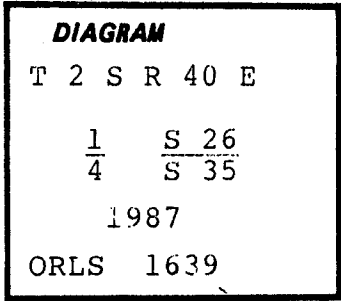

Description of corner evidence found:

Found a basalt stone 27 x 16 x 4 (record, 24 x 18 x 5) marked 1/4 lying downhill (E about 4') of its original position as determined by reversed record bearing and distance from the original BT which is...

A red fir 33" dia with "BT" bark scribed on smoothed bark and axe marks visible which brs N53°W, 29 lks at foot of precipice.

NOTE: A red fir 23" dia with healed blaze and signs 54-3 & 54-9 attached and referenced by recovery notes furnished by USFS brs N85°W, 30 lks was opened...No scribes were found on pitched over face.

Description of monument and accessories established to perpetuate the original location of this corner:

At position determined by reversed record bearing and distance from bark scribed section 26 BT....

Set 2½" aluminum cap on 2" aluminum pipe 20" in ground & 10" projecting out of ground with surrounding rock mound & 6' fence post alongside with sign 54-9 attached. Cap marked as shown in corner diagram. Buried stone alongside.

New bearing trees established:

A white fir 10" dia brs N46°E, 30.5' dist mkd 1/4S26 BT.

A white fir 17" dia brs S48°E, 29.4' dist mkd 1/4S35 BT.

Each BT has a sign 54-3 and signs 54-4 or 54-9 attached below a 6" band of red paint, and each new BT has a brass washer marked PLS 1639 nailed flush with BT blaze.

Compass declination 19° East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on September 02, 1987.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William L. Hanley

**OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639**

Office of.....County Surveyor..... County of.....Union.....

State of.....Oregon....., I hereby certify that the within instrument was filed in this office

for record on the..... day of....., 19.....

..... by

(COUNTY OFFICIAL)

(DEPUTY)

Form R6-7100-57 (9/71)

UNION COUNTY SURVEYOR	
Date Received	<u>9-22-88</u>
<small>GPO-781-311</small>	
Date Filed	<u>9-23-88</u>
By	<u>G. LANGLITZ, DEPUTY</u>
File No.	<u>141-88R</u>

7-19