


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E-9

History of original corner establishment:

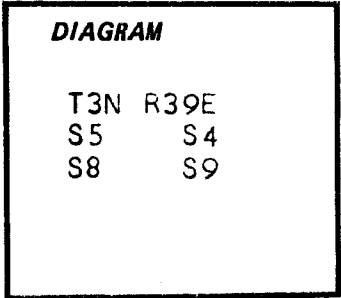

A WOODEN POST

- 10" FIR N59E 151ks. MKD. T3N R39E S4 BT
- 10" FIR S40E 19Lks. MKD. T3N R39E S9 BT
- 6" FIR S63W 10Lks. MKD. T3N R39E S8 BT

Description of corner evidence found:

20" LARCH S40E 12.5' SCRIBING VISIBLE

Description of monument and accessories established to perpetuate the original location of this corner:


SET A 2"x30" IRON PIPE WITH A BRASS-CAP MARKED:

T3N R39E  
 S5 S4  
 S8 S9  
 1978  
 RLS 346

- 22" FIR N16W 33.9' MKD. T3N R39E S5 BT
- 22" FIR N58E 62.9' MKD. T3N R39E S4 BT
- 6" FIR S35E 28.3' MKD. T3N R39E S9 BT
- 14" LARCH S63W 28.3' MKD. T3N R39E S10 BT

ALL BT'S HAVE A RED PAINTED STRIPE AND BEARING TREE TAGS. THE NEW BT'S HAVE A BRASS WASHER STAMPED RLS 346 NAILED TO THE LOWER FACE. THERE IS A 6' STEEL FENCE POST WITHIN 5' OF THE CORNER.

THERE IS A BLAZED LINE RUNNING EAST OF THIS CORNER. THE LINE RUNNING SOUTH HAS RECENTLY BEEN BRUSHED OUT.

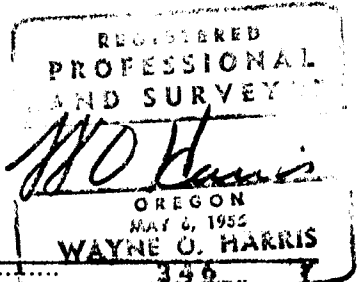

Office of..... COUNTY SURVEYOR ..... County of..... UNION .....  
 State of..... OREGON .....

I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by .....  
 (COUNTY OFFICIAL) (DEPUTY)

UNION COUNTY SURVEYOR

Date Received \_\_\_\_\_

Date Filed \_\_\_\_\_ ☆ GPO-798-276

By \_\_\_\_\_

File No. 132-83R

X