CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner monumented by F.W. Campbell in 1884 under contract No. 498, remonumented in 1978 by Wayne O. Harris on C.S.#N-9, G.L.O. records show A Stone, 10"X10"X6", 7" in the ground, with 3 notches on South and 4 notches on East edges. Fir 27" diam., S.74°E., 67 links mkd T3NR39ES21BT Fir 12" diam., S.6°W., 67 links, mkd. T3NR39ES20BT Pine 12" diam., N.14°W., 200 links, mkd. T3NR39ES17BT Cherry 8" diam., N.70°E., 116 links, mkd., T3NR39ES16BT

| N-9 | | |
|---------|------|--|
| DIAGRAM | | |
| - | R39E | |
| | S.16 | |
| S. 20 | S.21 | |
| | | |

Description of corner evidence found:

Stone in rock pile around monument set on C.S.#N-9 with "X" on top, 3 notches on South face and 4 notches on East face, moss on side of stone indicated it had been out of the ground and laying on its side many years. Ponderose Pine, 24"D.B.H., (12") N.14°W., 200 links, with scribe visible on face I opened. 45" D.B.H. Douglas Fir, (27") now a snag, S.74°E., 67 links, with scribes R39E S21 visible. No mention of Pine B.T. or Stone on C.S.#N-9.

Description of monument and accessories I established to perpetuate the original location of this corner:

Set a 2½" Diam. brass cap in a 2"X30" iron pipe at the intersection of the record distances from the two remaining B.T's. Cap Stamped T3N R39E The following references are to B.T's. Scribed on C.S.#N-9, not S12 S16 by me.

16" D.B.H. White Fir, S.81°W.,39.7', scribed T3NR39ES17BT

10" D.B.H. White Fir, S.21°W., 23.4', scribed T3NR39ES20BT

12" D.B.H. White Fir, S.38°E., 32.8', scribed T3NR39ES21BT

RP

8" D.B.H. White Fir, N.87°E., 15.0' scribed face partially healed, all B.T's. have B.T. tags, attention signs, and red painted bands

Standard Posts 4 O't North and East with attention. monument an S17. S16 S21 RPLS 1910 Steel fence posts 4.0' + North and East with attention, monument and boundary signs.

The brass capped iron pipe set by Wayne O Harris, which I rejected as being out of position, bears S. 3° 47' 35" W., 6.97 REGISTERED from the corner point I have monumented.

PROFESSIONS PROFESSIONAL LAND SURVEYOR

> Claster Must OREGON CLAYTON-JESSE MARTIN 1910

> > C.J. MARTIN SURVEYING 2751 JUNIPER ST. SWEET HOME, OR 97883

| Office of SURVEYOR County of UNION | |
|------------------------------------|---------------------------------|
| State of OREGON | NEARA COMMA |
| Form R6-7100-57 (9/71) | Date Received |
| | By File No. <u>158 - 83R</u> |

1.

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

DIAGRAM

T3N R39E

\$17 \$16

\$20 \$21

REGISTERED PROFESSIONAL AND SURVEYOR

A 10"x10"x6" BASALT STONE 7" IN THE GROUND

27" FIR S74E 67LKS. MKD. T3N R39E S21 BT 12" FIR S06W 67LKS. MKD. T3N R39E S20 BT 12" PINE N14W 200LKS. MKD. T3N R39E 17 BT 8" CHERRY N70W 116LKS. MKD. T3N R39E S16 BT

Description of corner evidence found:

34" FIR SNAG S74E 44.2' SCRIBING VISIBLE

Description of monument and accessories I established to perpetuate the original location of this corner:

SET 2"x30" IRON PIPE WITH BRASS-CAP MARKED: T3N R39E SI7 SI6 S20 S21 1978 RLS 346

14" FIR S40E 28.1' MKD. T3N R39E S21 BT 6" FIR N68E 17.6' MKD. 3N R39E S16 BT 8" FIR S35W 17.0' MKD. T3N R39E S20 BT 22" FIR N48W 39.3' MKD. T3N R39E S17 BT

ALL BT's have a red painted stripe and BT signs. The new BT's have a brass washer stamped RLS 346 nailed to the lower face. There is a 6' steel fence post within 5' of the corner.

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Original corner set by Herman D. Gradon, under GLO contract No. 517, dated September 30, 1884. Surveyor General Record States:

Set Basalt Stone 10 \times 8 \times 6, 7 ins. in the ground for cor. to secs. 16, 17, 20, and 21 marked with 3 notches on S and 4 notches on E edges,


From which:

A fir 6 ins. in diam. bears N13°E 32 lks. dist. marked T3NR40ES16 BT.

A fir 10 ins. in diam. bears S40°E 19 lks. dist. marked T3NR40ES21 BT.

A pine 30 ins. in diam. bears $S60^{\circ}W$ 68 lks. dist. marked T3NR40ES20 BT.

A fir 10 ins. in diam. bears N56°W 69 lks. dist. marked T3NR40ES17 BT.

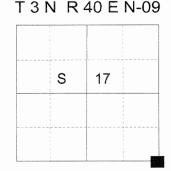

DESCRIPTION OF CORNER EVIDENCE FOUND:

Found

A 35" \times 15' down and decaying log with "T3N R40E S20 BT" scribes visible (South West BT). No sign of other bearing trees.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At record distance and bearing from stump hole of found South West bearing tree I set a 30" \times 2 $\frac{1}{2}$ " aluminum pipe with 3" aluminum cap marked as shown, 28" in the ground,

From which:

NEW BEARING TREES:

A 10" Douglas Fir bears North 39° East, a distance of 18.35 feet, marked T3NR40ES16 BT. A 14" Ponderosa Pine bears South 69° East, a distance of 9.95 feet, marked T3NR40ES21 BT. A 9" Douglas Fir bears South 64° West, a distance of 9.75 feet, marked T3NR40ES20 BT. An 11" Douglas Fir bears North 26° West, a distance of 30.00 feet, marked T3NR40ES17 BT.

Set steel fence post approx. 1 ft. West of monument.

Corner falls just off top edge of North/South running ridge on East face.


I hereby certify that the corner was perpetuated December 13, 2017.

Witness: Kyle Tucker

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2019

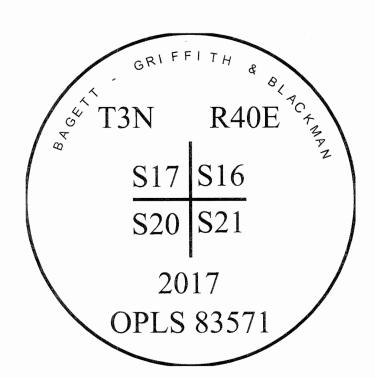

UNION COUNTY
SURVEYOR

Date Received 12/21/17

Date Filed 12/21/17

Filed By Characteristic Street S

I used a steel tape and magnetic compass in the establishment of the bearing trees and objects. Magnetic declination used was 13° East. Bearing is to a brass washer marked OPLS 83571 in the lower blaze of the trees. Distance is to a spike set in the root crown of the side of the trees.