UNION COUNTY SURVEYOR CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHMENT:

Corner not previously originally established.

No record of subsequent monumentation found in UNION COUNTY survey records.

DESCRIPTION OF CORNER EVIDENCE FOUND:

NONE

T 3 N R 39 E P-23

SEE SURVEY NUMBER 017-2005

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8"x30" iron pin with a 2 ½" aluminum cap marked as shown, 29 inches in the ground, from which:

NEW BEARING TREES:

A 9" diameter Douglas Fir bears N 45° E, a distance of 24.00 feet, marked C1/4 S24 BT.

A 13" diameter Douglas Fir bears S 30° E, a distance of 8.80 feet, marked C1/4 S24 BT.

A 15" diameter Tamarack bears S 54° W, a distance of 42.85 feet, marked C1/4 S24 BT.

A 12" diameter Ponderosa Pine bears N 51° W, a distance of 16.30 feet, marked C1/4 S24 BT.


Set a steel fence post approximately 1 ft. North of corner monument.

I hereby certify that the corner was monumented on September 6, 2005. Witness: Greg Blackman, Jr., Rick Thew

REGISTERED
PROFESSIONAL
LAND SURVEYOR
OREGON
JULY 17, 1986
RICK G. ROBINSON
2219

Renewal Date: December 31, 2006



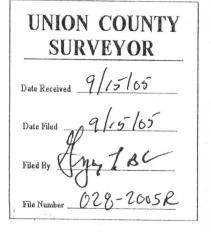

I used a steel tape and magnetic compass in the establishment of the bearing tree. I used 18° East declination, the distances are to a 60d spike driven into the right side of the root crown of the new bearing trees. A brass washer marked OPLS 2219 is attached to the BT blaze of the new bearing trees.