### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

V-13 DIAGRAM T3N R39E S28 S27 S33 S34

PROFESSIONAL LAND SURVEYOR

A WOODEN POST

24" PINE S65W 57LKS. MKD. T3N R39E S33 BT 24" PINE S57E 54LKS. MKD. T3N R39E S34 BT 20" FIR NO6E 22LKS. MKD. T3N R39E S27 BT 20" FIR NI5W 60LKS. MKD. T3N R39E S28 BT

Description of corner evidence found:

Form

RED PAINTED STAKE IN MOUND OF STONES

46" FIR NISW 39.6" SCRIBING VISIBLE

Description of monument and accessories I established to perpetuate the original location of this corner:

8" FIR S60W 46.7' MKD. T3N R39E S33 BT 14" FIR N60E 32.1' MKD. T3N R39E S27 BT 12" FIR S31E 64.8' MKD. T3N R39E S34 BT

SET A 2"x30" IRON PIPE WITH A BRASS-CAP MARKED: T3N R39E \$28 \$27 \$33 \$34 1978 RLS 346

ALL BT's have a red painted stripe and bearing tree tags. The new BT's have a brass washer stamped RLS 346 nailed to the lower blaze. There is a 6' steel fence post within  $5^{\circ}$  of the corner.

THERE IS A FENCE CORNER APX. 3' FROM THE CORNER.

	10 11 fleur
Office of COUNTY SURVEYOR County of UNION	OREGON MAY 3, 1955 WAYNE O. MARRIS 3 4 6
State ofOREGON , I hereby certify that the within instrument was filed for record on the day of, 19	in mindless comments
(COUNTY OFFICIAL) (DEPUTY)	
R6-7100-57 (9/71)	Date Filed \$\frac{1}{2} \text{GPO} -798-276
	Nile No. 172-83R

### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

## HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by F. W. Campbell, U.S. Deputy Surveyor, under GLO Contract No. 498, dated March 10, 1884. Surveyor General notes state: Set post 4 ft long 4 in square 24 ins in the ground for corner to secs 27-28-33 and 34 marked T3N S27 on NE, R39E S34 on SE, S33 on SW and S28 on NW faces with 3 notches on E and 1 notch on S edges, from which: A pine 24 ins diam bears S 65° W, 57 lks dist marked T3N R39E S33 BT

A fir 20 in diam bears N 6° E, 22 lks dist marked

T3N R39E S27 BT

A fir 20 in diam bears N 15° W, 60 lks dist marked T3N R39E S28 BT

In 1987, Wayne D. Harris reestablishes this corner from original evidence. Union County Monumentation record states: Red painted stake in mound of stones
46" Fir N15W 39.6' scribing visible
Set a 2"x30" iron pipe with a brass cap. From which:
8" Fir S60W 46.7' mkd. T3N R39E S33 BT
14" Fir N60E 32.1' mkd. T3N R39E S27 BT

12" Fir S31E 64.8' mkd T2N R39E S34 BT

S

T3N R39EV-13

27

## DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a 2 1/2" iron pipe with a 2 1/2" brass cap, marked as shown below, 10" above ground in a mound of stone 2 foot diameter. From which:

A 24" Douglas Fir bears North 63° East, a distance of 32.1 feet, alive with a healed blaze. An 18" Douglas Fir bears South 31° East, a distance of 64.8 feet, alive and vigorous with a healed blaze.

A 19" Douglas Fir bears South 60° West, a distance of 46.7 feet, alive and vigorous with a healed blaze.

A 39" Fir stump bears North 11° West, a distance of 40 feet, with scribe marks visible on opened blaze.

SEE SURVEY NUMBER 066-2015

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

From the pipe monument,

## **NEW BEARING OBJECTS:**


A 29" Ponderosa Pine bears North 62° West, a distance of 46.65 feet, marked T3N R39E S28 BT.

Witness: Thomas J. Kopp

I hereby certify that the corner was monumented on November 4, 2015.

REGISTERED **PROFESSIONAL** LAND SI OREGON JEFFREY S. HSU 83571

Renewal Date: June 30, 2017

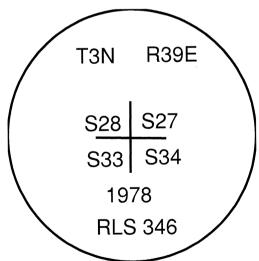

**UNION COUNTY SURVEYOR** 

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 15° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing tree. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing tree.