
CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner not previously established.

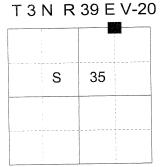

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 018-2020

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by survey, I set a 5/8"x30" iron pin, 28" in the ground, with 2 1/2" aluminum cap marked as shown below, in a collar of stone 2 ft. diam., from which:

NEW BEARING OBJECTS:


A 4" Ponderosa Pine bears North 69° East, a distance of 39.15 feet, marked X BT. An 8" Ponderosa Pine bears South 6° East, a distance of 5.30 feet, marked E 1/16 S35 BT.

Set a steel fencepost approx. 0.5 ft. West of monument. I hereby certify that the corner was monumented on May 29, 2020. Witness: Kyle A. Tucker

> REGISTERED **PROFESSIONAL** LAND SURVEYOR OREGON JEFFREY S. HSU

83571 Renewal Date: June 30, 2021

UNION COUNTY **SURVEYO**

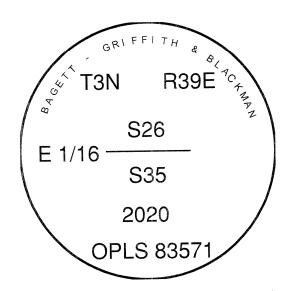

I used a steel tape and magnetic compass in the establishment of the bearing tree accessories. used 14° East declination, the distances are to a 60d spike driven into the side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.