


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Herman Gradon under GLO contract number 517 dated Sept. 30th, 1884. Surveyor General field notes state:

- Set a basalt stone 10 x 8 x 8, from which:
- A Pine 12 in. diam. bears N65°W 14 lks. dist. marked 1/4 SBT.
- A Pine 12 in. diam. bears S55°E 56 lks. dist. marked 1/4 SBT.

T 3 N R 40 E N-07

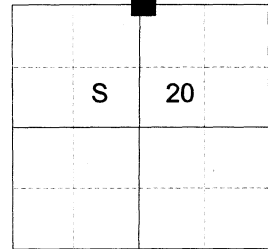

DESCRIPTION OF CORNER EVIDENCE FOUND:

None found. Area has been logged extensively with road construction in the area.

SEE SURVEY 036-2020

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position I set a 2 1/2" x 30" aluminum pipe, 25" in the ground, with 3" aluminum cap marked as shown below and in a 1.5' diam. collar of stone, From which:

NEW BEARING OBJECTS:


- A 15" Ponderosa Pine bears North 17° East a dist. of 24.80 ft., marked 1/4 S17 BT.
- A 20" Douglas Fir bears South 82° East a dist. of 57.65 ft., marked 1/4 S20 BT.
- An 8" Ponderosa Pine bears South 17° West a dist. of 22.20 ft., marked 1/4 S20 BT.
- A 9" Ponderosa Pine bears North 38° West a dist. of 54.75 ft., marked 1/4 S17 BT.

Set steel fence post bears East approx. 1'

Monument falls approx. 50' North of rock pit.

I hereby certify that the corner was monumented on October 15, 2020.

Witness: Kyle A. Tucker

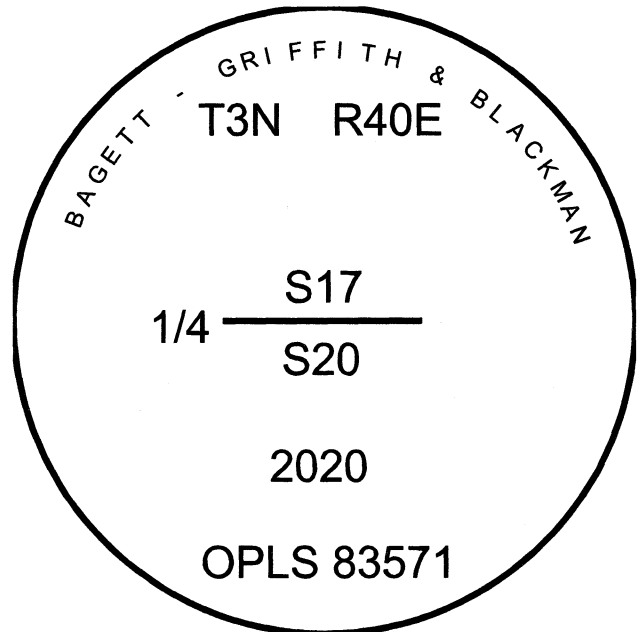

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2021

**UNION COUNTY
SURVEYOR**

Date Received 10/21/2020

Date Filed 10/21/2020

Filed By [Signature]

File Number 079-2020R

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.