


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**HISTORY OF ORIGINAL CORNER ESTABLISHED:**

Not previously established.

T 3 N R 40 E P-06

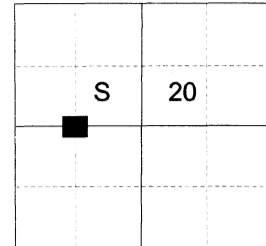

**DESCRIPTION OF CORNER EVIDENCE FOUND:**

None found.

SEE SURVEY 036-2020

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:**

At position by survey I set a 5/8" x 30" iron pin, 27" in the ground, with 2 1/2" aluminum cap marked as shown below and in a 1.5 ft. diam. collar of stone,  
From which:

**NEW BEARING OBJECTS:**


A 5" Douglas Fir bears North 66° East a dist. of 21.05 ft., marked CW 1/16 S20 BT.  
A 6" Douglas Fir bears South 4° West a dist. of 48.75 ft., marked CW 1/16 S20 BT.

Set steel fence post bears South approx. 1'

A remnant of a rock jack fence corner to West and South bearing fence lines bears North 46° West a dist. of 44 ft.

I hereby certify that the corner was monumented on October 20, 2020.

Witness: Kyle A. Tucker

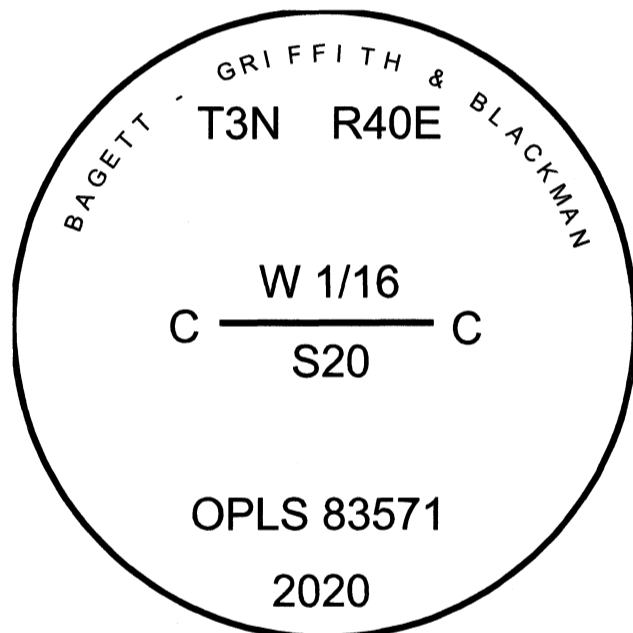

I used a steel tape and magnetic compass in the establishment of the new accessories. I used 14° East declination, the distances are to a 60d spike driven into the right side of the root crown of the bearing trees. A brass washer marked OPLS 83571 is attached to the BT blaze of the new bearing trees.



Renewal Date: June 30, 2021

**UNION COUNTY SURVEYOR**

Date Received 10/21/20

Date Filed 10/21/20

Filed By [Signature]

File Number 031-2020R