CERTIFIED RECORD OF LAND CORNER MONUMENTATION


HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Herman D. Gradon under GLO contract 517, dated September 30, 1884. Surveyor General field notes state:

Set a basalt stone 12x12x10 ins. 8 ins. in the ground for 1/4 sec. cor., marked 1/4 on N face, from which:

A fir 8 ins. in diam. bears $N5^{\circ}W$, 11 lks. dist. marked 1/4 S BT.

A fir 12 ins. in diam. bears S49°W, 13 lks. dist. marked 1/4 S BT.

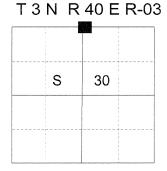

DESCRIPTION OF CORNER EVIDENCE FOUND:

None.

SEE SURVEY NUMBER 028-2016

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED

TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:

At proportionate position, I set a $2 \frac{1}{2}$ " x 30" aluminum pipe with $2 \frac{1}{2}$ " aluminum cap, marked as shown below, 20 inches in the ground, in a collar of stone 1 ft. diam., from which:

NEW BEARING OBJECTS:

A 5" Douglas Fir bears North 3° East, a distance of 105.50 feet, marked 1/4 S19 BT. A 4" Ponderosa Pine bears South 81° East, a distance of 100.25 feet, marked 1/4 S30 BT.


A 12" Ponderosa Pine bears West a distance of 50.85 feet, marked 1/4 S30 BT. A 5" Ponderosa Pine bears North 61° West, a distance of 42.50 feet, marked 1/4 S19 BT.


Drove a steel fencepost approx 1 ft East of monument. I hereby certify that this monument was set on August 30, 2016.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2017

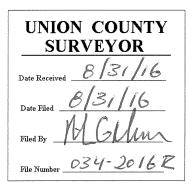

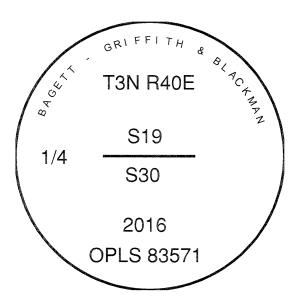

I use a steel tape and magnetic compass in the establishment of the bearing objects. Magnetic declination used was 15° East. Distances to the new trees are to a spike in the root crown of the trees. Bearings are to a brass washer in the lower blaze marked OPLS 83571.