


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

X-24

History of original corner establishment:

Corner was established by Survey No. 028-2004.

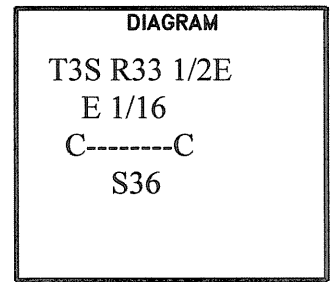

Description of corner evidence found:

None.

Description of monument and accessories I established to perpetuate the original location of this corner:

I establish the corner point by survey and set a 5/8" x 30" rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106, WA PLS 17372". Set steel fence post 5.5 feet South of corner monument. Corner falls on rocky ridge. Drove rebar monument to refusal and surrounded with mound of stone.

From the new corner monument:

A railroad spike set flush with the ground bears N 72° W, 4.20 feet. Wired 3/4 inch brass washer stamped "PLS 1106" to the railroad spike.
A 6" lodgepole pine bears S 48° W, 79.7 feet scribed C-E 1/16 S36 BT. Nailed 3/4" brass washer stamped "PLS 1106" to face of blaze.

This corner was monumented on September 13, 2004.

Used magnetic compass with 18° East declination and a steel tape to measure to bearing tree accessory.

Witness: Jason Wells, LSIT

Office of.....County of.....
State of, I hereby certify that the within instrument was filed in this office for record on theday of, 20.....

.....by.....

UNION COUNTY
COUNTY SURVEYOR

Date Received 10/1/04

Date Filed 10/10/04

By [Signature]

File No. 044-2004R

(DEPUTY)

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

renews 6-30-06