


**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

Index File No. P-21

**History of original corner establishment:**

Corner was originally established by Rufus S. Moore under GLO contract No. 451 during November, 1882. Surveyors Generals notes state: "Set a basalt sotne 18x8x7 ins., 12 ins. in ground for 1/4 sec. cor. marked 1/4 on W. face; from which: A pine 30 ins. diam. bears S82°E, 285 lks. dist. marked 1/4S BT. A fir, 36 ins. diam. bears S60°W, 181 lks. dist. marked 1/4S BT."

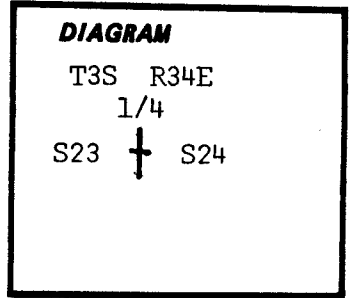

**Description of corner evidence found:**

Found no trace of record stone. A down and rotten 36" fir was checked for scribing. Only thing found was axe mark in bark. Measured N60°E, 119.5 ft., from here a rotten stump bears S79°E, 196.9 ft. This position is S70°W, 85 ft. from surveyed position.

**Description of monument and accessories established to perpetuate the original location of this corner:**

T3S R34E  
1/4  
S23 + S24  
OR PLS 1051  
1980

At surveyed position swt 2 1/2" X 30" galvanized pipe and brass cap marked: Set pipe 15" in the ground and mound of stone around to cap.

From which by magnetic declination of N20°E:

An 18" pine bears S65°E, 141.8 ft. scribed 1/4S24 BT. A 20" pine bears S62°W, 208.3 ft. scribed 1/4S23 BT. Painted blazes red and 6" red band around. Placed 54-3s, 54-4s and brass washers stamped PLS 1051 on BTs. Placed 54-2 and 54-4 on steel fence post 5' south of the corner.

I hereby certify that the above corner monument was reestablished as herein described,

Witnesses: Daniel Rowland  
Doug Moser

November 17, 1980

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Barry B. Barbour*

OREGON  
OCT. 17, 1975  
BARRY B. BARBOUR  
1051

Office of... County Surveyor ..... County of... Union  
Oregon  
State of....., I hereby certify that the within instrument was filed in this office  
for record on the 30th day of... January....., 1981.

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY SURVEYOR**

Date Received \_\_\_\_\_  
★ GPO—798-278

Date Filed \_\_\_\_\_

By \_\_\_\_\_


File No. 393-84 R

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

In 1882, under GLO Contract No. 451, Rufus S. Moore set a post, from which a 12" Pine bears N10°W, 125 lks. and a 10" Pine bears N46°E, 48 lks.

Index File No. P-21

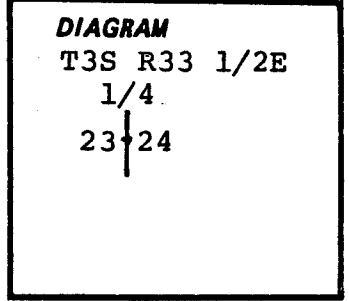

Description of corner evidence found:

Found 3" brass cap on 2 1/2" iron pipe rising 18" in mound, stamped:

Bearing trees found:

- A 16 1/2" P. Pine bears N46°E, 32.6 ft., scribing visible "1/4 S BT".
- A 15 1/2" P. Pine bears S14°W, 134.0 ft., scribing visible "1/4 S BT".

1/4 COR  
T3S R33 1/2E  
S23 | S24  
ORE LIC 381  
1970

Description of monument and accessories I established to perpetuate the original location of this corner:

Painted blazes and attached signs as per Standard Specifications for Cadastral Surveys, USFS Region 6, March 1982.

Compass Declination: 19 1/2°E  
Witness: G. Arrand

From 2115-125, follow 2115-126 northeasterly .6 mi. to where road hooks around the point of a ridge and goes west. Corner is about 50 ft. above the road on the left (south).

REGISTERED PROFESSIONAL LAND SURVEYOR
<i>B. Sutton</i>
OREGON JULY 13, 1970 B. A. SUTTON 1848

I hereby certify the above described corner monument and/or accessories was established as described on June 7, 1984.

Office of..... County of.....

State of..... I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)

<b>UNION COUNTY SURVEYOR</b>
Date Received <u>7-2-84</u>
Date Filed <sup>☆ GPO-798-274</sup> <u>7-3-84</u>
By <u>G. LANGLITZ, DEPUTY</u>
File No. <u>889-84R</u>