


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. T-21

History of original corner establishment:

Corner was originally established by Rufus S. Moore under GLO contract No. 451 during November, 1882. Surveyor General's notes state: "Set a basalt stone 18x15x8 ins., 12 ins. in the ground for 1/4 sec. cor. marked 1/4 on West face. From which: A pine 9 ins. diam. bears S42°E, 193 lks. diat. marked 1/4S BT. A pine 15 ins. diam. bears S53°W, 84 lks. dist. marked 1/4S BT."

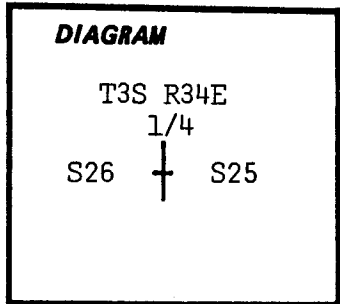

Description of corner evidence found:


Found no trace of record stone. Found down and rotten 20" pine scribed 1/4S BT. Measured N42°E, 125.0 ft. and found rotten pine stump S53°W, 57.1 ft.

Corner falls about 15' east of north-south fence.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the above point set 2 1/2" X 30" galvanized pipe and brass cap marked: Set pipe 24" in the ground and mound of stone around to cap.

From which by magnetic declination of N20°E: A 14" pine bears S78°E, 149.0 ft. scribed 1/4S25BT. A 14" fir bears N78°W, 58.2 ft. scribed 1/4S26 BT. Ols BT tagged. Painted blazes red and 6" red band around. Placed 54-3s, 54-4s and brass washers stamped PLS 1051 on BTs. Placed 54-2 and 54-4 on steel fence post 5' north of the corner.

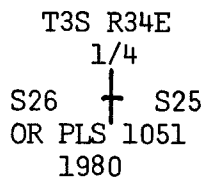

I hereby certify that the above corner monument was reestablished as herein described.

Witness: Daniel Rowland

October 16, 1980

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

Barry B. Barbour

OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1051

Office of.....County Surveyor..... County of..... Union
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the 30th day of January....., 1981.
..... by
(COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY
SURVEYOR**

Date Received _____
Date Filed _____
By _____
File No. 395-84R

☆ GPO-798-278