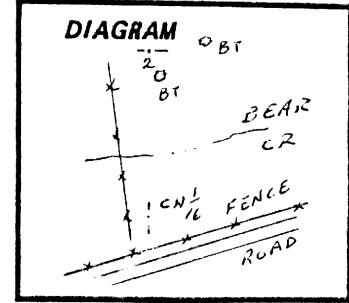


CERTIFIED RECORD OF LAND CORNER MONUMENTATION**History of original corner establishment:**


Not previously set.

**Description of corner evidence found:**

Not previously set.

UNION COUNTY SURVEYORDate Received 10-2-86Date Filed 10-13-86By G. LANGLITZ DeputyFile No. 177-86 R

SEE SURVEY 35-86

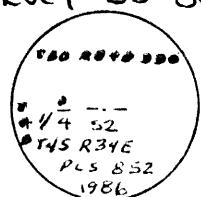**Description of monument and accessories I established to perpetuate the original location of this corner:**

Set a 2" x 30" galvanized iron pipe with 2½" brass cap marked: Pipe is set 26" into the ground with a collar of stone. A steel fence post is set 5' from the brass cap with a USFS Land Survey Monument sign attached.

Bearing Trees:

A 10" Douglas Fir bears N 76°00'E, 22.7' scribed $\frac{1}{4}$ S BT in a single blaze. A 16" Tamarack bears S30°00'E, 6.4" scribed $\frac{1}{4}$ S BT in a single blaze. A 3/4" aluminum washer stamped RLS 852 is nailed between the letters B and T on each tree. A 6" red band is painted around each tree and USFS Bearing Tree and Land Survey Monument signs attached. The corner is immediately south of a 53" Tamarack not used as a bearing tree.

I certify the above corner point was established as herein described on September 10, 1986.

REGISTERED PROFESSIONAL LAND SURVEYOR
David L. Haddock
OREGON JULY 12, 1988 DAVID L. HADDOCK 852


Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)

RECORD OF LAND CORNER MONUMENTATION

NORTH 1/4 CORNER SECTION 2, T. 4 S., R. 34 E., W.M.

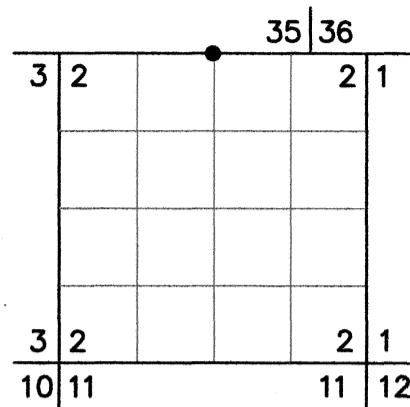

ORIGINALLY ESTABLISHED BY: David L. Haddock, PLS #852

SURVEY NUMBER: 35-86, filed November 18, 1986

UNION COUNTY MONUMENTATION NUMBER: 177-86R, filed October 13, 1986

ORIGINAL DESCRIPTION: Set a 2" x 30" galvanized iron pipe with 2½" brass cap marked: (diagram shown)
Pipe is set 26" into the ground with a collar of stone. A steel fence post is set 5' from the brass cap with a USFS Land Survey Monument sign attached.

Bearing Trees:

A 10" Douglas Fir bears N 76°00'E, 22.7' scribed ¼ S BT in a single blaze. A 16" Tamarack bears S30°00'E, 6.4" scribed ¼ S BT in a single blaze. A 3/4" aluminum washer stamped RLS 852 is nailed between the letters B and T on each tree. A 6" red band is painted around each tree and USFS Bearing Tree and Land Survey Monument signs attached. The corner is immediately south of a 53" Tamarack not used as a bearing tree.

EVIDENCE FOUND: Found a 2½" galvanized pipe with 2½" brass cap, marked as shown below, flush with ground with steel fence post with attached USFS 54-9 signs set south, 4.9 ft. from found monument.

From which I found the following bearing trees:


A Douglas-fir, 8" dbh, bears N. 76°00' E., 22.7 ft., found dead and down with visible scribe.

A western larch, 16" dbh, bears S. 23°E., 6.40 ft., with a healed blaze. Distance measured with steel tape to 60d nail driven side-center-right at the root crown, with an attached 1½" aluminum washer stamped PLS 69454.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

I accept the position of the found monument for the corner.

CORNER MONUMENT
MARKED:

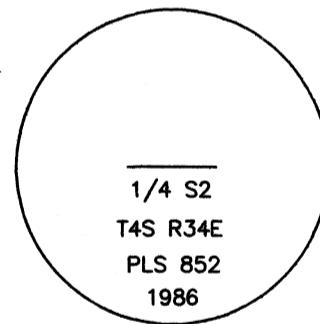

From which, I SCRIBE NEW BEARING TREES:

- A Douglas-fir, 22" dbh, bears N. 14° E., 37.61 ft., marked X in upper blaze, and BT in lower blaze. Distance measured with RTK GPS
- A western larch, 26" dbh, bears S. 70° W., 13.76 ft., marked X in upper blaze and BT in lower blaze. Distance measured with steel tape

Also from which, I SET NEW REFERENCE POINT:

- A 5/8"x24" iron pin, bears N. 69° W., 15.00 ft., with attached 2" aluminum cap marked RP 1 2025 PLS 69454. Distance measured with RTK GPS

Painted a 6" red band around each tree, and also painted the blazes red. Attached 54-3 and 54-9 signs to bearing trees. Bearings are geodetic, based on GPS observation at the corner. Distances to bearing trees measured to a 60d nail driven in the side-center-right at the root crown of each tree, with attached 1½" aluminum washer stamped PLS 69454.

RESTORATION BY, STAMP AND DATE:

Work performed September 25, 2025
Survey completed September 25, 2025

T. Jesus Quinones, LSIT

USDA FOREST SERVICE
NORTHEAST OREGON LAND ZONE
1550 Dewey Avenue, Suite A
Baker City, OR 97814
(541) 523-1283

UNION COUNTY SURVEYOR	
Date Received	12/18/25
Date Filed	12/18/25
By	
File No.	054-2025R

REGISTERED PROFESSIONAL LAND SURVEYOR	
OREGON NOVEMBER 30, 2007 JASON L. HATFIELD #69454	
EXPIRES: 6/30/2027	