


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File No. A-1 (T3S R35E)

History of original corner establishment:

Corner was originally established by Rufus S. Moore under GLO contract No. 451, on August 23, 1881. Corner was recovered by L. Wilkes, surveying group No. 38, in October, 1917. Surveyor General's notes state: "Intersect the cor. Tps. 2 & 3 S., Rs. 34 & 35 E., which is an old post, marked and witnessed as described by the surveyor general. I perpetuate this cor., as follows. At the exact cor. point set a volcanic stone, 28 X 20 X 12 ins., 12 ins. in the ground to bedrock and 9 ins. in mound of stone, for cor. to Tps. 2 & 3 S., Rs. 34 & 35E., marked with 6 notches on each edge: From which: A fir, 16 ins. diam., bears N72°15'E, 72 lks. dist. marked T2S R35E S31 BT (old BT). A fir, 18 ins. in diam., bears S42°30'E, 50 lks. dist. marked T3S R35E S6 BT. A fir, 20 ins. diam., bears S14°30'W, 56 lks. dist. marked T3S R34E S1 BT (old BT). A fir, 24 ins. diam., bears N50°W, 300 lks. dist. marked T2S R34E S36 BT (new BT).

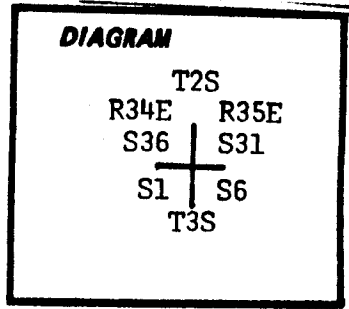


Description of corner evidence found:

Found 30 X 20 X 12 inch stone, firmly set and clearly notched on 4 sides. From which: A 19" dead pine bears N74°E, 47.9 ft., with faint scribing. A 16" pine bears S40°E, 33.9 ft., visible scribing. A 24" pine bears S15°W, 37.3 ft., with grown over blazes. A fir stump bears N50°W, 198.2 ft.

Description of monument and accessories I established to perpetuate the original location of this corner:

At the center of the above described stone, set 2 1/2" X 30" galvanized pipe and brass cap marked: Set pipe 12" in the ground to bedrock and mound of stone around to cap. Placed marked stone at base of mound.
 From which by magnetic declination of N20°E:
 A 14" pine bears N59°E, 86.3 ft. scribed T2S R35E S31 BT.
 A 12" pine bears N75°W, 29.3 ft. scribed T2S R34E S36 BT.
 Painted blazes red and 6" red band around. Placed 54-3s, 54-4s, and brass washers stamped PLS 1051 on the BTs. Old BTs are signed. Placed 54-2 and 54-4 on a steel fence post 5' north and 54-2 on a steel fence post 5' west of the corner.

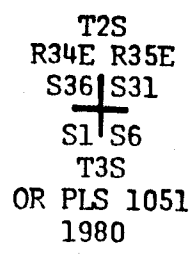

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Daniel Rowland
 Doug Moser

October 15, 1980

**REGISTERED
 PROFESSIONAL
 LAND SURVEYOR**

Barry B. Barbour

**OREGON
 OCT. 17, 1978
 BARRY B. BARBOUR
 1051**

Office of.....County.....Surveyor..... County of.....Union.....
 State of.....Oregon.....

I hereby certify that the within instrument was filed in this office for record on the...30th day of.....January....., 19...81.

..... by
 (COUNTY OFFICIAL) (DEPUTY)

**UNION COUNTY
 SURVEYOR**

Date Received _____

★ GPO—700-270

Date Filed _____

By _____

File No. 198-84 R